

#### 8-10, KITA-ITAMI, ITAMI **HYOGO 664-0831 JAPAN**

Overseas Sales Department TEL:(81)72-771-1112/1143 FAX:(81)72-772-7592 https://www.okk.co.jp E-mail:ovsd@okk.co.jp

#### Access map



OKK Inagawa factory

From Kansai International Airport: Please take a airport bus bound for Osaka (Itami) International Airport







Technical center is for test cutting, demonstration and training. M-plant is for machining and final assembly of machining center. W-plant is for final assembly of large sized machining centers. All are located at Inagawa, Itami city, Hyogo, Japan

#### INAGAWA PLANT:

8-10, KITA-ITAMI, HYOGO 664-0831 JAPAN TEL:(81)72-782-5121 FAX:(81)72-772-5156 E-mail:eigibu@okk.co.jp

#### OKK A DIVERSIFIED MANUFACTURER OF MACHINE TOOLS

#### **Specializes In:**

Machining centers

Graphite cutting machining centers

Grinding centers

**CNC** Milling machines

Conventional milling machines

Total die and mold making systems

Flexible manufacturing cells and systems

#### **Other Products Include: Textile Machinery**

**Water Maters** 

#### NOTE:

OKK reserves the right to change the information contained in this brochure wihtout notice.

OKK is not responsible to make changes to previously sold machines or accessories.

The machines in the photographs of this brochure may include optional accessories.

The export of this product is subject to an authorization from the government of the exporting country. Check with the government agency for authorization.

#### OKK USA CORPORATION

100 REGENCY DRIVE, GLENDALE HEIGHTS, IL 60139 USA

TEL:(1)630-924-9000 FAX:(1)630-924-9010

http://www.okkcorp.com E-mail:okkusa@okkcorp.com

#### OKK USA WESTERN REGIONAL OFFICE(LA)

17971 SKY PARK CIRCLE, SUITE D, IRVINE CA 92614 USA TEL:(1)949-851-6800

FAX:(1)949-851-6888

**OKK CANADA OFFICE(CANADA)** 79 REGAL ROAD, UNITS 17 & 18, GUELPH, ONTARIO NIK 1B6 CANADA TEL:(1)630-924-9000 FAX:(1)630-924-9010

#### OKK EUROPE GmbH

HANSEMANNSTR. 33 41468 NEUSS GERMANY TEL:(49)2131-29868-0

FAX:(49)2131-29868-41

http://www.okkeurope.com

E-mail:info@okkeurope.com

OKK Machinery (THAILAND) Co., Ltd. KUMTHORN HOLDING BUILDING 2nd FLOOR 897-897/1 Rama 3 Road, Bangpongpang, YANNAWA, BANGKOK 10120 THAILAND

TEL:(66)2-683-2160-2

FAX:(66)2-683-2163

#### PT. OKK INDONESIA

RUKO PODIUM MATARAM JL. MATARAM BLOK B No.22, CIBATU CIKARANG SELATAN, BEKASI 17530 JAWA BARAT INDONESIA TEL:(62)21-8991-1214

FAX:(62)21-8991-1227

#### OKK(SHANGHAI) CO., LTD.

ROOM 2506, 2201 YAN AN ROAD(W.) CHANGNING DISTRICT SHANGHAI. 200336 CHINA

TEL:(86)21-62700930

FAX:(86)21-62700931

http://www.okk.com.cn E-mail:shanghai@okk.com.cn

#### OKK CORPORATION SEOUL BRANCH

1203, E & C DREAM TOWER 8, 327-27, GASAN-DONG, GEUMCHEON-GU, SEOUL, 153-023 KOREA

TEL:(82)2-855-0416 FAX:(82)2-855-0426









#### Horizontal Machining Center


## HM SERIES =

HM 400 HM5100 HM630 HM800

**HMI000** 

HM5005 HM60005 HM8005 **HMIOOOS HMI2505** 



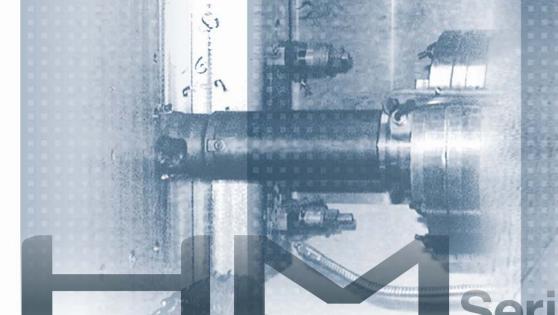

**Horizontal Machining Centers** 

HM-series horizontal machining centers are built with OKK's exceptional designs and provided with superior performance ensuring high-speed machining, rigidity, reliability, and chip evacuation. Heavy cutting capability is just one of HM-series specialties achieved by incorporating a highly developed rigid box-shaped frame.

Add to that the implementation of only the best in high-speed motors, and extremely reliable ATC's (auto tool changer) and APC's (auto pallet changer) that deliver minimal chip to chip time, truly merging max performance with production proven reliability.



#### HM400 HM5005


#### Main specifications

#### HM400/40, HM400/50

Travel X x Y x Z mm (in) =630 (24.80) x 620 (24.41) x 710 (27.95) Rapid traverse rate m/min (ipm)=54 (2,126) Pallet size square mm (in) =400 (15.75)

HM500S/40, HM500S/50

Travel X x Y x Z mm (in) =630 (24.80) x 620 (24.41) x 710 (27.95) Rapid traverse rate m/min (ipm)=54 (2,126) Pallet size square mm (in) =500 (19.69) \*/40:BT40 type, /50:BT40 type

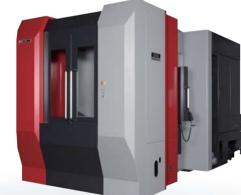

#### HM5100 HM60005

#### Main specifications

#### HM5100

Travel X x Y x Z mm (in) =800 (31.50) x 750 (29.53) x 880 (34.65) Rapid traverse rate m/min (ipm) = [Std] XZ: 75 (2953), Y: 60 (2362) Pallet size square mm (in) =500 (19.69)

#### HM6000S

Travel X x Y x Z mm (in) =800 (31.50) x 750 (29.53) x 880 (34.65) Rapid traverse rate m/min (ipm) = [Std] XZ: 75 (2953), Y: 60 (2362) Pallet size square mm (in) =630 (24.8)



#### HM630 HM8005

#### Main specifications

Travel X x Y x Z mm (in)=1050 (41.34) x 900 (35.43) x 900 (35.43) Rapid traverse rate m/min (ipm) = [Std] 54 (2126) = [Opt] 75 (2953)

Pallet size square mm (in) = 630 (24.8)

Travel X x Y x Z mm (in)=1050 (41.34) x 900 (35.43) x 880 (34.65) Rapid traverse rate m/min (ipm) = [Std] 54 (2126)

= [Opt] 75 (2953)

Pallet size square mm (in)= 800 (31.5)



## **HMI0005**

#### Main specifications

Travel X x Y x Z mm (in) =1400(55.12)x1100(43.31)x1050(41.34) Rapid traverse rate m/min (ipm) = 48(1889) Pallet size square mm (in) =800(31.5)

Travel X x Y x Z mm (in) =1400(55.12)x1100(43.31)x1000(39.37) Rapid traverse rate m/min (ipm) = 48(1889) Pallet size square mm (in) =1000(39.37)



#### Main specifications HM1000

Travel X x Y x Z mm (in) =1700(66.93)x1400(55.12)x1400(55.12) Rapid traverse rate m/min (ipm) = 48(1889)

Pallet size square mm (in) =1000(39.37)

Travel X x Y x Z mm (in) =1700(66.93)x1400(55.12)x1240(48.82) Rapid traverse rate m/min (ipm) = 48(1889)

Pallet size square mm (in) =1250(49.21)

[Std] Standard equipment or function [Opt] Optional equipment or function

#### CONTENTS

OKK

Main features	P01
Features	P03
Chip disposal	06
High speed and heavy-duty cutting	07
Spindle power and	
torque diagram	09
Pallet table and APC	11
High precision structure	12
Tool magazine	13

ATC(Automatic tool changer)	15
Powerful feeding	16
Accuracy	17
Cutting capacity	18
Operations	19
Maintenance	20
Standard and option list	21
Option	P 22

Controller	P31
F31i-B	3
FAi	32
Specifications	P33
HM400/HM500S	3
HM5100/HM6000S	3
HM630/HM800S	3
HM800/HM1000S	39
HM1000/HM1250S	4

#### HM400/HM5005

With more rigid construction than conventional models, responding to the needs to machining a wide range of products from iron and cast iron to mold and die parts.

Not only the rigidity but also spindle speed, rapid traverse, reliability and machining performance have been upgraded.

HM400/40 and HM500S/40 models come equipped with a 10000min<sup>-1</sup> spindle, with an output of 37/26/22kW (50/35/30HP) available in BT40 spindle taper, as well as the option for a 15000min<sup>-1</sup> or 20000min<sup>-1</sup> spindle.

HM400/50 and HM500S/50 models have a standard spindle reaching 12000 min<sup>-1</sup>, with an output of 30/25kW (40/34HP) available in BT50 spindle taper, with an optional 8000 min<sup>-1</sup>. Allows customers the best option for the job.

The unique clamp construction provides excellent sealing performance by clamping while increasing the internal pressure of the table, thus preventing the infiltration of coolant enhancing the durability of the machines.





High rigid linear roller guides are used for all axes of X, Y and Z.

The ball screws are core-cooled ball screws and pre tensioned by double-anchor method. Cooling oil is forced to all ball screws, ball screw support housings and motor mounting surfaces.

The fine-feed movement and the lost motion property have been improved. The circular cutting accuracy is also improved significantly.

#### Characteristics

- \* The machining time is significantly improved by increasing all of speeds.
- \* The ball screws are core-cooled ball screws and double anchored.
- \* Option of a BT40 is with 10000 min<sup>-1</sup> or BT50 with 12000 min<sup>-1</sup> is available to meet your machining needs.
- \* One piece shutters are used for X and Z axes and avoids chips and coolant going to inside.

(only Z-axis shutter is one piece type for HM400/50 and HM500S/50.)


#### HM5100/HM60005 HM630/HM8005 HM800/HM10005

Double the speed, rigidity, reliability, durability, etc. compared with the conventional machines enable high-speed and high-accuracy machining of wide-ranging materials including hard-to-cut materials such as ferrous and casting materials.


In addition to the high rigidity of the machine main unit, highly-rigid linear roller guides on the X, Y and Z axes generate a synergetic effect and improve further the cutting performance.

Increase in the rapid-traverse rates, ATC speed, table turning speed and APC speed has shortened the non-cutting time and improved production efficiency.

For the improved heavy-duty cutting performance, the machine has a BT50 large-diameter ø100mm (3.94") spindle and a 45/30/26kW (60/40/35HP) high-power motor.

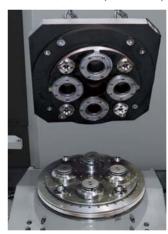

Built - in - Rotary Table (BRT) use a new mechanism of precision reduction-gear roller drive. This drive system achieved high speed table indexing and toughness against overload or impact. \*1

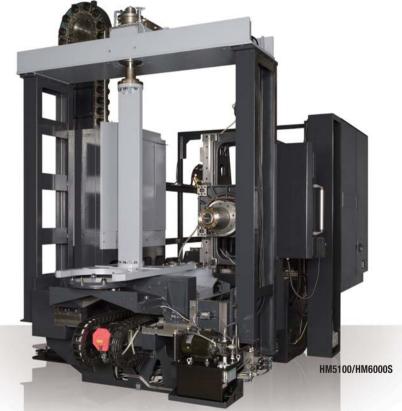

Pallet positioning and clamping
Use of taper cones ensures high accurate repeatability of pallet positioning and flatness of the pallet is secured by means of OKK's original design multiple-clamp method."<sup>2</sup>

Master pallet is available as option.\*3

#### Characteristics

- \* Linear roller guides are capable the six times more moment load than a conventional model.
- \* BRT use the high speed and high rigid reduction-gear roller drive that is more than double the rigidity and clamping torque compared to a conventional model. \*1


•				
Specifications	Spindle speed (min-1)	Type of tool shank	Spindle bearing inner diameter (mm)	Rapid traverse rate (m/min)
HM5100/HM6000S	10000			75 (2953 ipm)*5
HM630/HM800S	12000	BT50	ø100 (3.94")	54 (2126 ipm) [Opt. 75 (2953 ipm)]*5
HM800/HM1000S	8000			48 (1889 ipm)

- \*1: HM800/HM1000S and HM1000/HM1250S use worm shaft and worm wheel. \*2: HM400/HM500S is using center-clamping method. \*3: Master pallet is available only for HM5100/HM6000S.
- \*4: Additional option available rapid traverse rate to 75m/min(2953ipm) for X-axis and Z-axis. \*5: An air tank is necessary to attach a balance cylinder to Y axis. The air tank needs local procurement at machine export.

#### HM Series

#### HM1000/HM12505

All HM models are highly effective in machining cast-metal and iron-based work pieces, including construction machinery parts, such as cylinder blocks with massive valves requiring maximum rigidity for custom tooling and large molds.

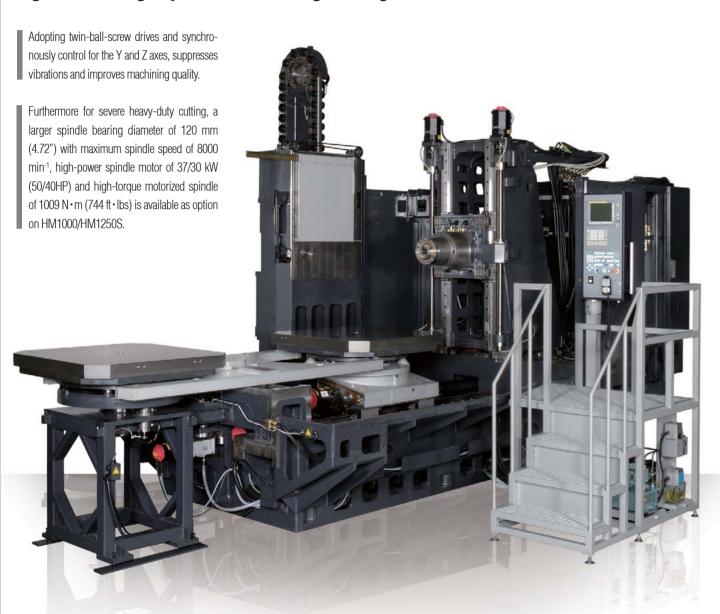

#### Characteristics


- \* HM1000 and HM1250S models standard spindle delivers 12000min<sup>-1</sup>, with a bearing diameter of 100mm (3.94") and 30/25kW (40/34HP), 420N·m (310 ft·lbs) of torque.
- \*Twin-ball-screws for both Y-and Z-axes, aiding in vibration dampening yielding extended tool life. The design focus is reduction of machining time, while increasing precision, surface finish, and contouring accuracy.
- HM-series are proven in high production machining environments and are ready to cut aluminum to cast metals.




Z axis twin-ball-screw

The Z-axis shutters and B-axis are angled sharply, allowing for excellent chip evacuation. Furthermore, OKK added a solid Y-axis shutter to eliminate any problems previously caused from chips clogging on un-maintained slide rails.

#### Thorough chip processing measures

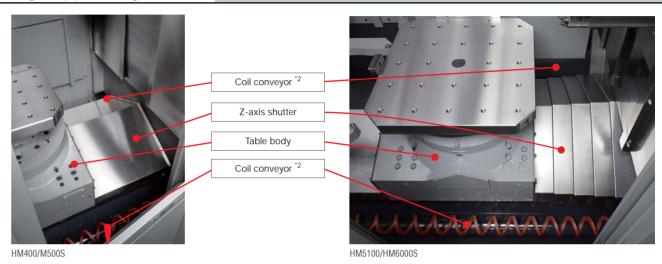

Chips are flushed so that they fall into the troughs on both sides of the table. Then, the chips are flushed out with coolant supplied though the nozzles provided in the front-end section of each trough. The coolant and chips are collected in the chip tank in the rear part of the machine (Chip flow coolant \*1). In place of the standard method that flushes out chips with coolant, you may use optional coil-type chip conveyor \*2 to clear the troughs and to discharge chips through the outlet in the rear part of the machine.

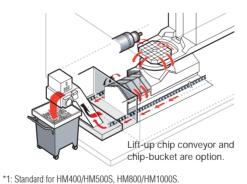

\*2: Standard for HM5100/HM6000S, HM630/800S, HM1000/HM1250S.

The troughs are extended and chips at the setup station can be collected



Chip flow coolant \*1

Chips are discharged from the troughs to outside of machine by big volume of coolant.

30 nozzles for HM630/HM800S

#### Ceiling shower [Opt]\*3

Coolant through nozzles on the ceiling i.e. ceiling shower can be provided optionally for prevention of chips from accumulating on fixtures and workpieces.

\*3: Standard for HM5100/HM6000S.







26 nozzles for HM400/HM500S 50 nozzles for HM800/HM1000S

27 nozzles for HM5100/HM6000S 91 nozzles for HM1000/HM1250S

HM1000/HM:

HM630/HM800S HM100

05 I

#### **High Speed and Heavy-duty Cutting**



#### HM400/HM500Ss3

standard spindle specification is motorized spindle, maximum speed 10,000min<sup>-1</sup> with grease lubrication, BT40 and 37/26/22kW (50/35/30HP). Optional spindles 15,000min<sup>-1</sup> and 20,000min<sup>-1</sup> are oil-air lubrication.


Cutting data		
Machine model	HM400/40	
Material	S50C	
<b>Tool</b> ø32 mm (1.26") Long end milli		
Length of the tool from tool holder nose	130 mm (5.12")	
Spindle speed	1300 min <sup>-1</sup>	
Feed rate	6500 mm/min (256 ipm)	
Depth of cut	0.5 mm (0.02")	
Width of cut	20 mm (0.79")	



The BT50 spindle rotating at 12000 min<sup>-1</sup> secures the 45/30/26kW (60/40/35HP) output. For the bearing lubrication, the machine uses the oil-air lubrication. The spindle specification can be selected according to the details of machining.


Cutting data		
Machine model	HM630	
Material	S50C	
Tool	ø80 mm (3.15") High feed end mill	
Spindle speed	600 min <sup>-1</sup>	
Feed rate	4000 mm/min (157.48 ipm )	
Depth of cut	1 mm (0.04")	
Width of cut	80 mm (3.15")	

#### Spindle Cooling

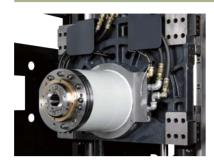


Circulating the temperature-controlled oil around the spindle housing minimize the spindle temperature fluctuation.


MS: Motorized spindle

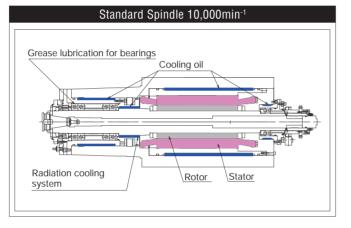

#### Spindle Cooling

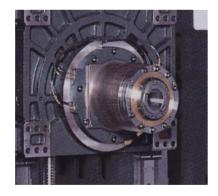

The spindle bearings are oil-air lubricated. Circulating temperature controlled oil is in the groove around the spindle housing suppressing the growth of the spindle. Furthermore, OKK's unique radiant cooling system prevents the conduction of heat generated from the motor into the spindle.

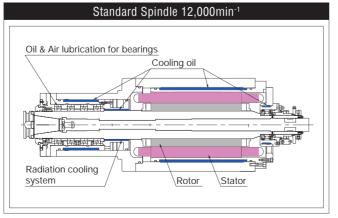

The standard spindle used for **HM800/HM1000S** is the BT50 spindle having the output of 30/25 kW (40/34 HP) and rotating at 8000 min<sup>-1</sup>. The maximum torque of 420 N·m (310 ft·lbs) can provide high power in the low-speed range.Both the heavy-duty cutting and the high-speed machining are available owing to the highly-rigid spindle with ø100mm (3.94") spindle bearing inner diameter and the oil-air lubrication system.


Cutting data		
Machine model	HM1000S	
Material	Mold steel (SKD61)	
Tool	ø80mm (3.15") End milling	
Length of the tool from tool holder nose	200mm (7.87")	
Spindle speed	1600mm <sup>-1</sup>	
Feed rate	1920mm/min (75.6in/min)	
Depth of cut	4.0mm (0.16")	
Width of cut	60.0mm (2.36")	



#### HM630 / HM800S and HM800 / HM1000S Gear-drive spindle [Opt]

Max. torque: 1251N·m (923ft·lbs)

As an option to deliver more torque for machining of hard-to-cut materials, an 8000min<sup>-1</sup> high torque gear-drive spindle produces 1251 N·m (923 ft·lbs). Available on HM630/HM800S and HM800/HM1000S.

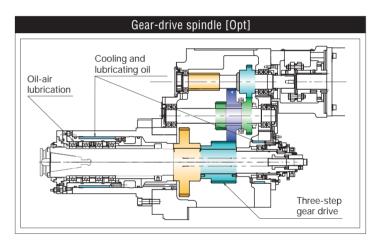

#### Power of tool clamp

MS spindle			
Machine model Spindle speed 10000min <sup>-1</sup>		Spindle speed 15000min <sup>-1</sup>	Spindle speed 20000min <sup>-1</sup>
HM400/40, HM500S/40	10000N (2200lbf)	10000N (2200lbf) [Opt]	10000N (2200lbf) [Opt]


MS spindle			
Machine model Spindle speed 12000min <sup>-1</sup> Spindle speed 8000min <sup>-1</sup>			
HM400/50, HM500S/50	16300N (3700lbf)	16300N (3700lbf) [Opt]	
HM5100/HM6000S	16300N (3700lbf)	_	
HM630/HM800S	16300N (3700lbf)	16300N (3700lbf) [Opt]	
HM800/HM1000S	16300N (3700lbf) [Opt]	17700N (4000lbf)	
HM1000/HM1250S	16300N (3700lbf)	20600N (4600lbf) [Opt]	


Gear spindle		
Machine model Spindle speed 8000min <sup>-1</sup>		
HM630/HM800S	19600N (4400lbf) [Opt]	
HM800/HM1000S	19600N (4400lbf) [Opt]	




|07|

#### FANUC #40

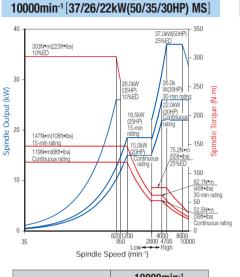

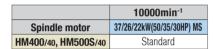


#### 15000min<sup>-1</sup> [37/26/18.5kW(50/35/25HP) MS]

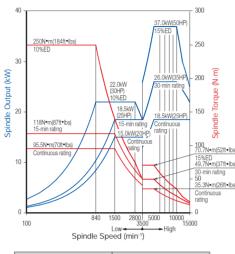


	, ,
	15000min <sup>-1</sup>
Spindle motor	37/26/18.5kW(50/35/25HP) MS
HM400/40, HM500S/40	Option

#### 20000min<sup>-1</sup> [37/26/18.5kW(50/35/25HP) MS]

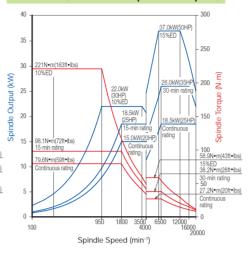

	20000min <sup>-1</sup>
Spindle motor	37/26/18.5kW(50/35/25HP) MS
HM400/40, HM 500S/40	Option


#### ○ FANUC / #50

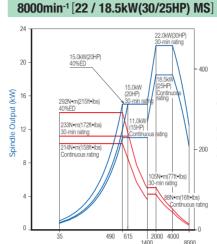

8000min <sup>-1</sup>								
22/18.5kW(30/25HP) MS								
Option								
_								
_								
_								
_								

-: not available


#### 8000min<sup>-1</sup> [22 / 18.5kW(30/25HP) Gear]

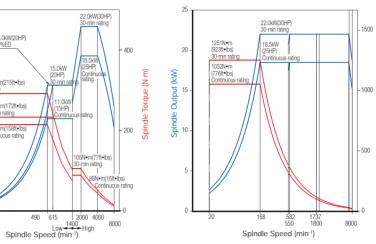

8000min <sup>-1</sup>						
22/18.5kW(30/25HP) Gea						
_						
_						
Option						
Option						
_						

-: not available


#### 8000min<sup>-1</sup> [30 / 25kW(40/34HP) MS]

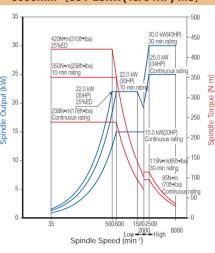

8000min <sup>-1</sup>								
Spindle motor 30/25kW(40/34HP) I								
HM400/50, HM500S/50	_							
HM5100/HM6000S	_							
HM630/HM800S	_							
HM800/HM1000S	Standard							
HM1000/HM1250S	_							


-: not available

#### 8000min<sup>-1</sup> [37 / 30kW(50/40HP) MS]

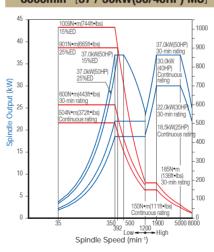


8000min <sup>-1</sup>							
Spindle motor	37/30kW(50/40HP) MS						
HM400/50, HM500S/50	_						
HM5100/HM6000S	_						
HM630/HM800S	_						
HM800/HM1000S	_						
HM1000/HM1250S	Option						

-: not available

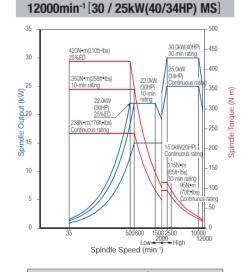

12000min <sup>-1</sup>								
Spindle motor	30/25kW(40/34HP) MS							
HM400/50, HM500S/50	Standard							
HM5100/HM6000S	_							
HM630/HM800S	_							
HM800/HM1000S	Option							
HM1000/HM1250S	Standard							

#### 12000min<sup>-1</sup> [45/30/26kW(60/40/35HP) MS]

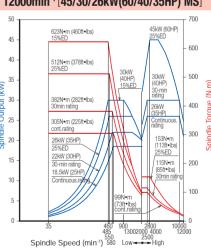

12000	)min <sup>-</sup> '				
Spindle motor	45/30/26kW(60/40/35HP) MS				
HM400/50, HM500S/50	_				
HM5100/HM6000S	Standard				
HM630/HM800S	Standard				
HM800/HM1000S	Option				
HM1000/HM1250S	Option				

-: not available

#### HIGH PRECISION STRUCTURE

HM Series

#### Table Indexing, Rotating Time and Accuracy

For the IT (Index Table) specification, the table index accuracy of 2.5 seconds is guaranteed by using the large-diameter curvic couplings.


For the BRT (Built-in Rotary Table) specification, that has a rotary encoder as standard equipment, the table index accuracy of 2.5 seconds is guaranteed.

Machine model	Type of table	Index and rotation time (per 90°)		
HM400/HM500S	BRT	0.5 sec		
ทเพสบบ/ทเพอบบอ	IT[Opt]	1.9 sec		
HM5100/HM6000S	BRT	0.5 sec		
HINISTOU/HINIOUUS	IT[Opt]	1.7sec		
HM630/HM800S	BRT	0.6 sec		
HIVIOSU/HIVIOUUS	IT[Opt]	1.7 sec		
HM800	ΙΤ	4.5 sec		
HM1000S	IT	5.5 sec		
HM800/HM1000S	BRT[Opt]	1.2 sec		
HM1000/HM1250S	ΙΤ	5.0 sec		
HIN 1000/HIN 12303	BRT[Opt]	1.8 sec		



#### Structure of BRT

## Drive with new method (HM400/HM500S, HM5100/HM6000S, HM630/HM800S)

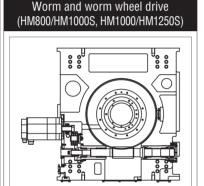

M400/HM500S, HM5100/HM6000S, and HM630/HM800S models incorporate a newly designed table with a highly rigid reduction gear in place of a conventional worm shaft and wheel. This gear has minimal backlash, holds up to impact, and performs table indexing accurately at higher speeds.

HM800/HM1000S and HM1000/HM1250S models use large-diameter bearings backing OKK's continuous improvements on rigidity.

#### **Direct Turn APC (Automatic Pallet Changer)**

The HM Series exploits the direct-turn APC unit consisting of only a pallet lift and turning mechanism. Fewer parts mean less downtime. HM1000 and HM1250S a table load of 5000kg (11000 lbs) is available as an option. All APC units have been built with expansion in mind whether it's a pallet pool or transfer system, flexibly supporting a variety of machining environments.


Machine model	Pallet changing time*1	Max. loadable weight on pallet kg (lb)*2
HM400	9.5 sec	450 (992)
HM500S	9.5 sec	450 (992)
HM5100	10.5 sec	800 (1764)
HM6000S	10.5 sec	700 (1543)
HM630	<b>M630</b> 15 sec 1300 (2600	
HM800S	15 sec	1200 (2900)
HM800	19 sec	2000 (4400)
HM1000S	21 sec	2500 (5500)
HM1000	32 sec/43 sec[Opt]	3000 (6600)/5000 (11000) [Opt]
HM1250S	35 sec/43 sec[Opt]	3000 (6600)/5000 (11000) [Opt]





#### HM5100/HM6000

#### **High Precision Structure**

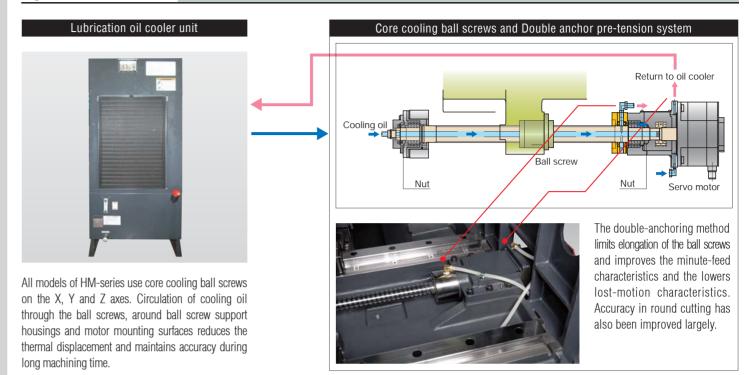

#### **Double Anchored Core Cooling Ball Screw, and Linear Roller Guides**

#### HM400/HM500S






#### HM5100/HM6000S





#### HM1000/HM1250S



#### **Tool Magazine for BT40**

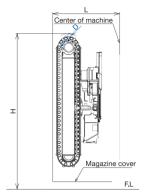

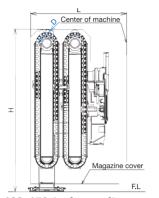

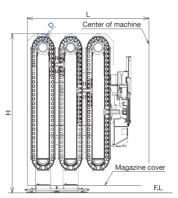

40, 60, 80-tool capacity magazine

120, 156-tool capacity magazine

178, 232-tool capacity magazine


Machine Model	HM400/40, HM500S/40							
Tool storage capacity <sup>*1</sup>	L mm (in)	L mm (in) H mm (in)						
40tools [Std]		2480 (97.64)						
60tools [Opt]	1315 (51.77)	3065 (120.67)						
80tools [Opt]		3915 (154.13)						
120tools [Opt]	1060 (72.22)	3150 (124.02)	ø160 (6.30)					
156tools [Opt]	1860 (73.23)	3875 (152.56)						
178tools [Opt]	2405 (04 50)	3150 (124.02)						
232tools [Opt]	2405 (94.69)	3875 (152.56)						

<sup>\*1:</sup> The number of tool storage capacity refers a total number including the tool installed in the spindle i.e. subtract one from the above for the actual number of storage capacity.

<sup>\*2:</sup> D shows the max. diameter of tool without tool in adjacent pot. It is ø82mm (3.23") when tool is in adjacent pot.





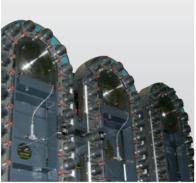



40-tool capacity [Std]


60-tooll x 2magazines=120-tool capacity [Opt]


#### **Restriction of tools**


Machine model	Max tool length		Max. diameter without in adjacent pot	Max.weight of tool	Moment load	
	mm (in)	mm (in)	mm (in)	kg (lb)	N·m (ft·lbs)	
HM400/40, HM500S/40	400 (15.75) *1	ø82 (3.23) *1	ø160 (6.30) *1	12 (26.5) *2	9.8 (7.2)	

<sup>\*1:</sup> It is loadable under the restriction. (Refer to P34)

#### **Tool Magazine for BT50**

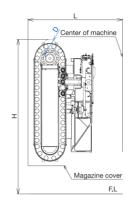

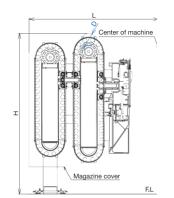

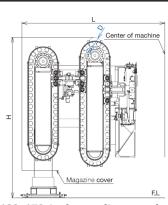

40, 60-tool capacity magazine

80, 116-tool capacity magazine

120, 176-tool capacity magazine

Machine Model	HM40	HM400/50, HM500S/50 HM5100/HM6000S HM630/HM800S		HM5100/HM6000S H		00S	HM800/HM1000S			HM1000/HM1250S																				
Tool storage capacity <sup>*1</sup>	L mm(in)	H mm(in)	D mm(in)*2	L mm(in)	H mm(in)	D mm(in) <sup>2</sup>	L mm(in)	H mm(in)	D mm(in)*2	L mm(in)	H mm(in)	D mm(in) <sup>2</sup>	L mm(in)	H mm(in)	D mm(in) <sup>*2</sup>															
40 tools [Std] <sup>*1</sup>	1715 (67 50)	2970 (116.93)		1000/70 25\	2915 (114.76)		2005 (79)	3170 (124.8)		0100 (0E 0)	3375(132.9)		2220 (01.7)	3650 (143.7)																
60 tools [Opt]*3	1715 (67.52)	4170 (164.17)	(164.17)	1990(78.35)	4115 (162.01)		2000 (19)	4370 (172.1)		2180 (85.8)	4335(170.7)		2330 (91.7)	4610 (181.5)																
80 tools [Opt]	0E00 (00 C4)	3210 (126.38)	6.38) 4.17) ø250 (9.84)	~050 (0.04)	38) ~250 (0.04)	~050 (0.04)	~750 (0.04)	~050 (0.04)	~050 (0.04)	~750 (0.04)	~750 (0.04)	~050 (0.04)	~050 (0.04)	~050 (0.04)	~050 (0.04)	~050 (0.04)	~050 (0.04)	~050 (0.04)	~050 (0.04) 0005(	3155 (124.21)	~000 (11 01) 00	2820 (111.1)	3410 (134.3)	~270 (10 62)	0005 (447.0)	3615(142.3)	~070 (10 60)	0400 (404.4)	3890 (153.2)	ø270 (10.63)
116 tools [Opt]	2530 (99.61)	4170 (164.17)		2835(111.61)	4115 (162.01)		2020 (111.1)	4370 (172.1)	g270 (10.63)	2995 (117.9)	4335(170.7)	10210 (10.03)	3160 (124.4)	4610 (181.5)	WZ1U (10.03)															
120 tools [Opt]	0050 (440 00)	3210 (126.38)	1 [	0410(404 00)	3155 (124.21)		0400 (400 0)	3410 (134.3)		2205 (420.7)	3615(142.3)		044F (40F C)	3890 (153.2)																
176 tools [Opt]	2850 (112.20)	4170 (164.17)		3150(124.02)	4115 (162.01)		3120 (122.8)	4370 (172.1)		3295 (129.7)	4335(170.7)		3445 (135.6)	4610 (181.5)																

<sup>\*1:</sup> The number of tool storage capacity refers a total number including the tool installed in the spindle i.e. subtract one from the above for the actual number of storage capacity. (40, 60-tool magazine)
\*2: D shows the maximum diameter of tool when without tool in adjacent pot. It is ø115mm (4.53") when tool is in adjacent pot.
\*3: Standard for HM5100/HM6000S.









60-tool capacity [Opt]

40-tool x 2 magazines=80-tool capacity [Opt]

-: not available

#### **Restriction of tools**

Machine model			Max. diameter with tool in adjacent pot <sup>*1</sup>	Max. diameter without in adjacent pots '1	Max. weight of tool	Moment load
	Standard mm (in)	Option mm (in)	Standard mm (in)	mm (in)	kg (lb)	N·m (ft·lbs)
HM400/50, HM500S/50	400 (15.75)	_	ø115 (4.53)	ø250 (9.84)	25 (55) *2	29.4 (21.7)
HM5100/HM6000S	600 (23.62)	_	ø115 (4.53)	ø300 (11.81)	30 (66) *2	29.4 (21.7)
HM630/HM800S	500 (19.69)	600 (23.62)	ø115 (4.53)	ø270 (10.63)	25 (55) *3	29.4 (21.7)
HM800/HM1000S	500 (19.69)	600 (23.62)	ø115 (4.53)	ø270 (10.63)	25 (55) *3	29.4 (21.7)
HM1000/HM1250S	600 (23.62)	_	ø115 (4.53)	ø270 (10.63)	25 (55)	29.4 (21.7)



Matrix magazine [Opt]

- \* The maximum work diameter is to be smaller when 600mm (23.62") tool length is used. (HM630/800S)
- \* When three or more multiple magazines, 600mm (23.62") length tools are usable in the first and second magazines.
- In the 3rd or the following magazines, the maximum tool length shall be limited to 500mm (19.69").

  \*1: It is loadable under the restriction. (Refer to P34, P36, P38, P40, P42)
- \*2: Required slow ATC speed.
- \*3: 30kg (66lbs) for the gear head spindle

<sup>\*2:</sup> required slow ATC speed.

#### POWERFUL FEEDING

Use of the OKK's proven and original high-speed synchronous tool changer (OKK patented) provides the steady tool change and excellent durability. In order to realize the smooth tool change operation, the standard specification includes the variable ATC function and, when the ATC handles the tool such as the heavy tool and the large-diameter tool, the ATC turning speed slows down automatically if the slow turning is selected at the time of tool registration.

#### **BT40**

Max.time the farthest position to waiting position of magazine							
60-tool magazine base 80-tool magazine base							
60-tool	13 sec	80-tool	16.5 sec				
120-tool	26.7 sec	156-tool	31.3 sec				
178-tool	36.2 sec	232-tool	47.1 sec				


Tool c	hange time (cut to cut)
Machine model	Standard
HM400/40, HM500S/40	3.3 sec



Max.time the farthest position to waiting position of magazine							
40-tool mag	gazine base	60-tool mag	gazine base				
40-tool	10.0 sec	60-tool	13.5 sec				
80-tool	30.3 sec	116-tool	37.3 sec				
120-tool	33.2 sec	176-tool	40.2 sec				
160-tool	34.2 sec	236-tool	41.2 sec				

Tool change time (cut to cut)							
Machine model	Standard	Gear-drive spindle					
HM400/50, HM500S/50	4.2 sec	_					
HM5100/HM6000S	3.6 sec	_					
HM630/HM800S	4.4 sec	5.0 sec					
HM800/HM1000S	5.8 sec	6.0 sec					
HM1000/HM1250S	6.2 sec	_					

\* 600mm (23.62") tool length specification is standard only for HM1000/HM1250S. The other models are option.

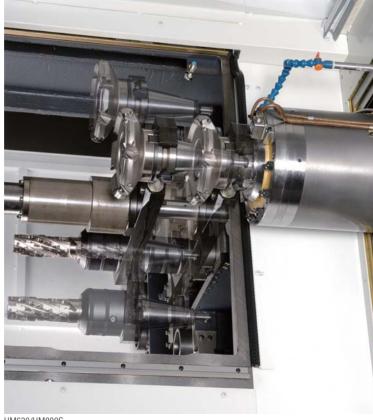

HM630/HM800S



Cutting data					
Machine model	HM800				
<b>Tool</b> ø100mm (3.94") Face milling					
Material FC300 (Cast iron)					
Spindle speed 800 min <sup>-1</sup>					
Feed rate	800mm/min (31.50 in/min)				
Depth of cut	<b>Depth of cut</b> 3.0mm (0.12")				
Width of cut	90.0mm (3.54")				



The machines use an intense linear roller guide system that is simply built to last, through all high feed rates, rapid accelerations and performs superbly in high-load machining.

#### Ball screw with pre-lubricated seals

In order to reduce the environmental burdens, the grease lubrication method is used for lubricating the ball screws / feed guides.



#### Pallet positioning and clamping

Use of taper cones ensures high accuracy in repeated positioning of the pallets. Flatness of the pallet is secured accurately by means of the multi-clamp method. (HM400/HM500S use center clamp method.)



Multi-clamp method


#### CUTTING CAPACITY

#### Soft scale II m [Spindle thermal displacement compensation function]


Thermal displacement of the spindle can be a cause for fluctuating machining accuracy. The soft scale llm reduces thermal displacement of the spindle and provides stable machining accuracy. The soft scale IIm constantly monitors a rotating status of the spindle and temperature of the spindle and the machine body in order to compensate automatically the thermal displacement according to changes in machine movement and based on the accumulated OKK's original data.

#### Spindle thermal displacement (HM630 actual data example



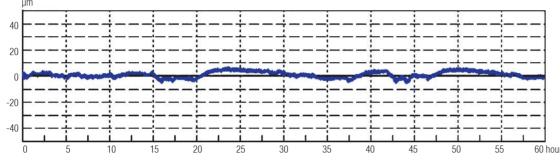


#### Z axis

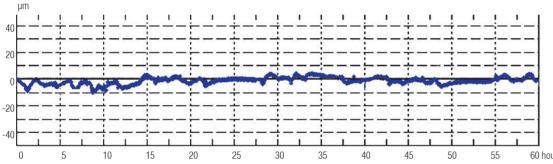

Cutting data					
Spindle speed 0∼12000 min <sup>-1</sup>					
Room temperature	21C° (±1C°)				
Total running hours 60 hours included warming up time					

<sup>\*</sup> Due consideration should be taken for the machine installation status, environmental temperature and operating condition. The data here may not be obtained due to these conditions.

#### **Accuracy of roundness**

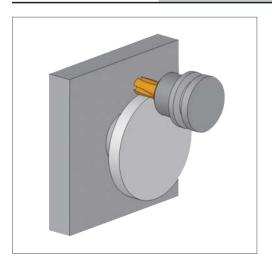


Roundness	Tolerance	Actual data example
HM400/HM500S	15 <i>µ</i> m(0.00059")	3.6 <i>µ</i> m(0.00014")
HM5100/HM6000S	15 <i>µ</i> m(0.00059")	3.8µm(0.00015")
HM630/HM800S	15µm(0.00059")	3.3 <i>µ</i> m(0.00013")
HM800/HM1000S	15µm(0.00059")	4.5µm(0.00018")
HM1000/HM1250S	15µm(0.00059")	5.0µm(0.00020")

Data condition				
Material Alminum				
Cutting dia	250mm (9.85")			
Feed rate	F500mm/min (19.7in/min)			

- 1. The data show example which obtained in short run. It may differ from data obtained in continuous run.
  2. The data were obtained under OKK's test cutting conditions. The data may differ due to conditions of cutting tools, fixtures, cutting speed and room temperature.
- 3. The above accuracy are subject to machine installed according to OKK specifications and constant temperature environment. Accuracy are based on OKK inspection standard.


#### **Cutting data**

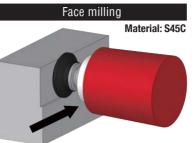



Material: S45C

HM400/40, HM500S/40

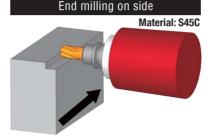

	HM400/40, HM500S/40 ø32mm (1.26") x6 - tooth		HM630/HM800S HM800/HM1000S ø50mm (1.97") x6-tooth Roughing end mill				
Spindle speed	250 min <sup>-1</sup>	160 min <sup>-1</sup>	160 min <sup>-1</sup>	160 min <sup>-1</sup>			
Cutting width	32 mm (1.26")	32 mm (1.26") 20 mm (0.79") 25 mm (0.1		15 mm (0.59")			
Cutting depth	16 mm (0.63")	40 mm (1.57")	40 mm (1.57")	50 mm (1.97")			
Feed rate	200 mm/min (7.87 in/min)	180 mm/min (7.09 in/min)	160 mm/min (6.3 in/min)	300 mm (11.8 in/min)			
Cutting amount	102 cm <sup>3</sup> /min (6.2 in <sup>3</sup> /min)	144 cm³/min (8.8 in³/min)	160 cm <sup>3</sup> /min (9.8 in <sup>3</sup> /min)	225 cm³/min (13.7 in³/min)			

HM5100/HM6000S

ø100mm (4") x6 - tooth | ø125mm (4.9") x6 - tooth | ø125mm (4.9") x6 - tooth


HM1000/HM1250S

ø125mm (4.9") x6 - tooth

300 min-1

100 mm (3.94")

6 mm (0.24")

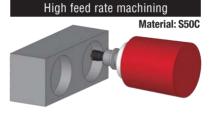


#### High feed rate machining Material: S50C

Face milling

	HM630/HM800S, HM800/HM1000S ø50mm (1.97") High feed rate cutter	
Spindle speed	1400 min <sup>-1</sup>	
Cutting width	40 mm (1.57")	
Cutting depth/round	0.5 mm (0.02")	
Feed rate	7000 mm/min (276 in/min)	

#### Sample work pieces

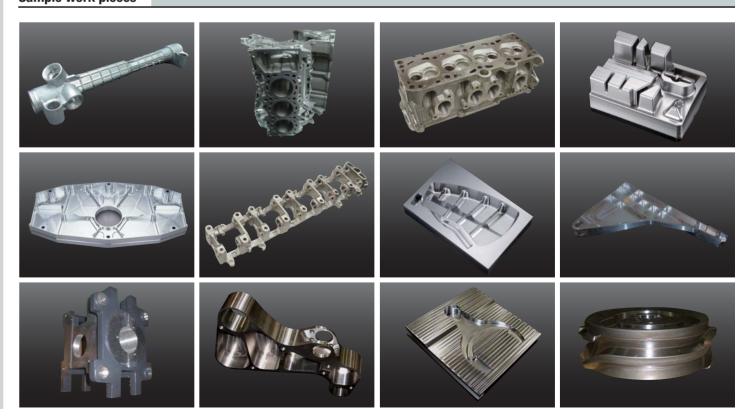

#### **Easy Operation**

By the design of swivel operation panel and considerate splashquard of accessibility, the accessibility to spindle and pallet is significantly improved.







HM400 / HM500S

HM800 / HM1000S

#### **Easy loading and unloading**

Front door of the APC opens wide so that the work loading/unloading and setup operations can be carried out easily.





HM1000 / HM1250S

HM5100 / HM6000S

#### Easy Tool Loading and Unloading in Tool Magazine

#### 1 Magazine interruption function [Std]

During automatic operation, the tool loading and unloading operation in the tool magazine can be executed.

#### 2 Operation panel [Opt]

Through a simple operation, a tool corresponding to a designated tool number is called up to the setup position inside the magazine.

#### **3** Foot-operated switch for removing a tool [Opt\*]

The foot-operated switch eases removal of a tool from a magazine pot.

\*: Standard for Dual-contact holder



#### **Operation Stand [Opt]**




The operation stand is supplied optionally as needed.

\*: Standard for HM1000/HM1250S

Photo is an example of operation stand.

#### Maintenance

Daily maintenance equipment is easily performed at the back and one side of machine.

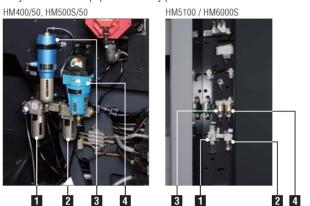


Name of equipment

Air regulator

Air lubricator

Air dryer

Oil -in-air removing unit

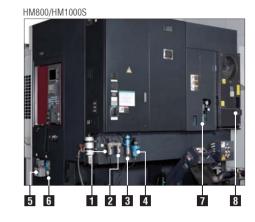

Name of equipment

Manual oil supply for magazine

Spindle oil-air unit

Hydraulic unit

Oil temperature control unit for Spindle and screws

Automatic Jubrication unit for

magazine and ATC part [Opt]



linear guides and ball screws [Opt]

#### Eco friendly

1

2

#### ECO sleep function [Standard]

Daily maintenance equipment

If the machine remains idle longer than the specified time period, the machine's present mode is switched to a power-saving mode to reduce wasteful consumption of power, air and so on. When the power-saving mode is active, the equipment such as servos and chip conveyors are turned off. It is cancelled automatically when the setup operation is completed i.e. when the doors are closed.

No.

5

6

7

OKK has an added advantage of eco-friendly reliability with our use of a hydraulic free, mechanical cam driven ATC unit.

The machine incorporates LED lamps due to their low heat generation and power consumption savings. Furthermore, the LED lamps have a long life to save replacement money and maintenance.


#### Turning off lights inside the machine [Opt]


When the machine is not operated for a certain period of time, lights inside the machine are turned off automatically.




#### Easy return of ATC and APC

Tools and pallets can be returned easily to origin position in accordance with monitor, even if stopped at half way of ATC and APC.

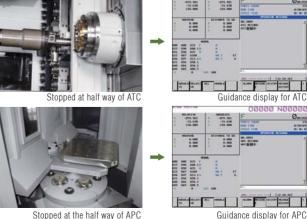

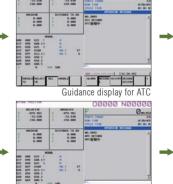

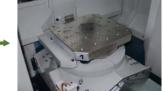

Pallet returned to origin position

<sup>\*1:</sup> Except for HM400/40, HM500S/40 and HM5100/HM6000S

#### OPTIONAL PERIPHERAL EQUIPMENT


				Standard and optional Accessories			Standard	Optio	n	Not availab
					HM400/40	HM400/50	HM5100	HM630	HM800	HM1000
Item					HM500S/40	HM500S/50	HM6000S	HM800S	HM1000S	HM1250S
Con			FAi							
Controller	FAN	IUC	F31i							
욕			F31i-B5 BT40	Essential for the 5-axis simultaneous control						
Spindle taper and pull stud	Taper Two faces		BT50							
<b>₩</b>			HSK-A63							
aper	contact		HSK-A100							
and	CONTROL	HOIGOI	BT type							
틸	D. II		OKK90°							
stud	Pull stud		MASI MASII							
十			10000min <sup>-1</sup>	37/26/22kW (50/35/30HP)						
3	BT40	MS	15000min <sup>-1</sup>	37/26/18.5kW (50/35/25HP)						
Maximum spindle speed			20000min <sup>-1</sup>	37/26/18.5kW (50/35/25HP)						
≣				22/18.5kW (30/25HP)						
발		MS	8000min <sup>-1</sup>	30/25kW (40/34HP)						
de s	BT50	Gear		37/30kW (50/40HP)						
pee	-			22/18.5kW (30/25HP) 30/25kW (40/34HP)						
-		MS	12000min <sup>-1</sup>	45/30/26kW (40/34HF)						
_†	т. і	alo.	IT( Index Table)	Least Index 1°						
Table/Axis	Tab		BRT(Built-in rotary table)	Least Index 0.001°						Least Index 0.000
Axi:			nin (2953ipm )				X-axis • Z-axis only			
s /	Addition o	f controlled		Land	*1	*1	*1	*1	*1	*1
			40MG	40MG×1			*4			
			60MG 80MG	60MG×1 80MG×1			*4			
	RT	Γ40	120MG	62MG×2						
		-A63	156MG	80MG×2						
			178MG	62MG×3						
			232MG	80MG×3						
L			200MG/300MG/400MG	Matrix magazine						
3			40MG	40MGX1						
Magazine			60MG	60MGX1		*2	*2	*2	*2	*2
ine			80MG 116MG	44MG+40MG 60MG×2		*2	*2	*2	*2	*2
		T50	120MG	44MG+40MG×2		2	2	2	2	2
	HSK-	-A100	160MG	44MG+40MG×3						
			176MG	60MG×3		*2	*2	*2	*2	*2
			236MG	60MG×4		*2	*2	*2	*2	*2
I.			200MG/300MG/400MG	Matrix magazine						
		Interruption								
		operation pa r remove by		Standard for BT50/HSK Dual-contact holder						
$\dashv$	1001 Holde	i iciliove by	2-pallet APC	Statitudia for biso/fisk budi-contact florder						
골	4.5	0.0		6-pallet APC						
E E	Al	PC	Multiple APC	8-pallet APC						
For Automatic pallet			Separate setup station for the multiple APC Note 1							
ic pa	Б		Tapped type Pallet		25-M16 screw	25-M16 screw	24-M16 screw	24-M16 screw	24-M16 screw	24-M16 screw(*
를	Pa	llet	T-Slot type Pallet Additional Pallet							
$\dashv$			Standard Coolant tank							
	Coola	nt tank	Lift up chip conveyor	Hinged type/Scraper type/with Draum filter						
ᇎᅡ	01.		Coil conveyor	Bed left and right						
For Co.	Unip e	ejection	Chip flow coolant	Bed left and right						
olan			Spindrecoolant nozle							
tan			Ceiling Shower							
olant and Ghip conveyor			Coolant shower gun							
6 b	Col	llant	Air blow and oil mist Coolant through spindle	2MPa (290psi )/7MPa (1015psi )						
inve	CUI	am	Air through spindle	ZIVII a (ZUUPSI )/ / IVIII''d (TUTDPSI )						
yor			Oil hole							
			Oil skimmer							
$\perp$			Mist collector							
린			sion ball screw	With core cooling ball screw						
acct		n oil cooler		Wy suis as W7 suis						
	Linear sca Coolant co	le feed back		XY-axis or XYZ-axis						
	Signal tow			Tow lamp without buzzer						
	Working li			LED light						
	Workpiece a		Touch sensor TO	Manual measurement						
	measuremer	nt	Touch sensor T1-A	Workpiece automatic measurement						
era	Tool length r	measurement	Touch sensor T1-B	Workpiece automatic measurement/ Tool length automatic measurement/ Tool break detection						
cces	and break de		Touch sensor T1-C	Tool length automatic measurement/Tool break detection						
= -	Tool break d		Tool break detection in magazine*4	Contact type or laser type						
0, 1			ication unit	XYZ -axis/ball screw						
/			on unit for MG and ATC part	Bond anabasing math						
- 15	EUHHUUSTIO1	ıı parıs tor n	nachine anchoring	Bond anchoring method						
	Rotary win	woh		at operation door						

Note 1: The separate setup station for the multiple APC is regarded as the standard specification when the multiple pallet specification is selected. (Except for HM400/500S and HM5100/HM6000S)


- \*1: The controller needs to be changed when the 5-axis simultaneous control is selected.

### \*2: It is not available for the HSK-A100. \*3: Twenty-four M20s are used for HM1250S. \*4: It is available only for the FANUC controller.

#### High pressure coolant through spindle [Opt]

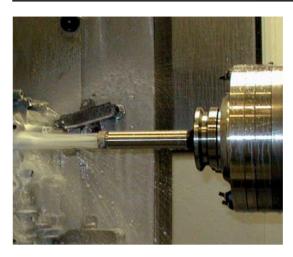

Discharge pressure Mpa (psi)		2.0 (290)	7.0 (1,015)
Discharge volume	50Hz	36 (9.5)	21 (5.5)
L/min (gpm)	60Hz	35 (9.2)	30 (7.9)

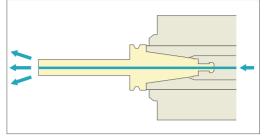

High pressure coolant is supplied to the tip of a cutting tool through the center hole of spindle and the cutting tool. It is very efficient for chip removal, cooling the cutting point and extending the life of cutting tools. Air supply through the spindle is also available by switching a valve. [Another Opt]



Air blow nozzle [Opt]

\*Discharge values indicated are at the outlet of pump.

\*Actual discharge volumes from the tool are different due to the hole-diameter of cutter tools.



High pressure coolant unit



#### Coolant shower gun [Opt]



Automatic lubrication unit for magazine and ATC part [Opt]\*2



Mist collector [Opt]\*3




Mist collector suctions mist from the splash guards and is recommended when high-pressure coolant is used.

#### Automatic grease lubrication unit for linear guides and ball screws [Opt] \*1



Oil mist & Air blow [Opt]

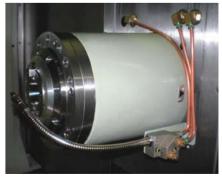

<sup>\*1:</sup> Only for HM630/HM800S, it is regarded as the optional specification. \*2: Standard for HM5100/HM6000S, HM1000/HM1250S.


<sup>\*3:</sup> We can provide the mounting holes in the splash guard and a terminal block for wiring in the control panel for the customer to install the equipment that the customer prepares for themselves.

**HM** Series

#### For more stable machining accuracy


#### Coolant cooler [Opt]


Oil temperature has a major factor in thermal displacement of machine. Coolant cooler suppresses rise of temperature generated during machining and achieves a stable machining accuracy. This option is recommendable for accurate machining. This option is also strongly recommended, when the oil-based coolant is used.

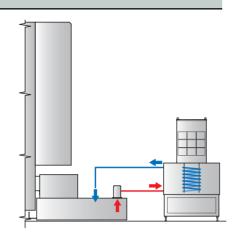

#### Spindle

#### Dual-contact [Opt]

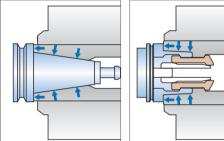

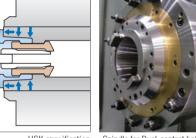





BT specification

HSK specification Spindle for Dual-contact holder of BT50 Dual-contact holder is loaded, no space

between holder and spindle nose.

Improvements in rigidity of tools have been achieved by contact faces of spindle-nose and tool holders flange. This has a great effect not only for heavy load machining but also high speed machining.

(The performance is different due to the cutting tools and cutting conditions.)


#### Stopper block [Opt]


- 1) For high speed spindle holder
- 2) For high speed spindle holder with coolant jacket
- 3) For angle head

Notes: Please inform OKK the brand name and model when you order this stopper block.

#### Type of pull stud

	7/24 taper No.40	7/24 taper No.50
OKK90°	Option	Standard
MASI	Standard	Option
MASII	Option	Option

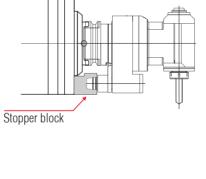

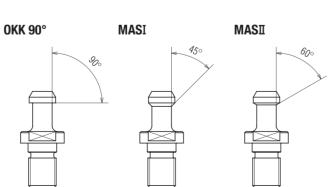

#### Lift up chip conveyor [Opt]

#### Suitable lift up chip conveyor according to type of chips

Type of chip conveyor		Hinge type Scr		Scrap	Scraper type N		Magnet Scraper type		Scraper type with drum filter		Magnet scraper type with drum filter		
			Use or not use coolant oil	Use	Not use	Use	Not use	Use	Not use	Use	Not use	Use	Not use
			Short curl	0	0	0	0	0	0	$\circ$	-	0	-
	S		Spiral COOO	0	0	△*2	∆*2	△*2	△*2	×	-	×	-
	e chip	Steel	Long ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	0	0	×	×	×	×	×	-	×	-
	izabl		Needle shape	×	∆*1	×	0	○*3	0	0	-	0	-
s	Magnetizable chips		Powder and small lump	×	∆*1	×	0	○*3	0	0	-	0	-
chips	Σ	iron	Needle shape	×	∆*1	×	0	○*3	0	0	-	0	-
Type of		Cast	Powder and small lump	×	∆*1	×	0	○*3	0	∆*3	-	0	-
	ips		Short curl	×	0	∆*4	0	-	-	0	-	0	-
	ble chi	ε	Spiral 80000	0	0	0	0	-	-	∆*5	-	∆*5	-
	netiza	Alminum	Long ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	0	0	0	0	-	-	∆*5	-	∆*5	-
	Non-magnetizable chips	A	Needle shape	×	∆*1	×	0	-	-	0	-	0	-
	N.		Powder and small lump	×	∆*1	×	0	-	-	0	-	0	-

- \*1 Minute chips can enter the conveyor through a gap on the hinged plate. So, inside of the conveyor needs frequent cleaning.
- \*2 Scraper can easily catch long chips. So, shortening the chips (for example by using the step feed) or removing such chips is required.
- \*3 When flow rate of the coolant is large, filters can be clogged with chips flowed out of the conveyor case. Therefore, combined use with a magnet plate is
- \*4 When flow rate of the coolant is large, filters can be clogged with chips flowed out of the conveyor case. Therefore, filters require frequent cleaning.
- \*5 Scraper can easily catch long chips. Therefore, periodical removal of chips is needed. If they remain, a drum filter may be damaged.

#### Height of chip drop

Type of chip conveyor	Hinged type, Scraper type and Magnet scraper type	Scraper type with drum filter	Magnet craper type with drum filter
HM400/HM500S	1020 mm (40.16")	1100 mm (43.31")	1100 mm (43.31")
HM5100/HM6000S	1020 mm (40.16")	1220 mm (48.03")	1220 mm (48.03")
HM630/HM800S	1020 mm (40.16")	1220 mm (48.03")	1220 mm (48.03")
HM800/HM1000S	1070mm (4213")	1200mm (4724")	1200mm (4724")
HM1000/HM1250S	1070mm (4213")	1200mm (4724")	1200mm (4724")



#### Magnet separator [Opt]



As an option for the lift-up chip conveyor, adding a magnet separator is possible for collecting powder and particle casting chips and preventing accumulation of chips inside tanks and clogging of devices such as pumps and filters.

#### Oil skimmer [Opt]



Oil skimmer collects contaminated oil from a coolant tank.

#### Rotary wiper [Opt]



Install on operators window

#### Automatic measurement and Tool breakage detection with OKK Touch sensor system [Opt]

#### Model of touch sensor system

Function	Description	Systen	n name
Workpiece measurement and compensation	<ul> <li>Load the touch sensor into the spindle.Automatic operations will bring the sensor or into contact with the workpiece.</li> <li>The workpiece coordinate system will be measured and the necessary compensation amount will be updated.</li> <li>Program instructions are issued according to the specified format.</li> </ul>	T1-A	
Tool length measurement	When a tool is commanded for tool leugth check. automatic operations will bring the tool in contact with the table mounted touch sensor. This operation will update the tool leugth offset for that tool.     Measurement and compensation programs in accordance with the specified format are produced and executeed.     Applicable tools: Drills and taps	T1-C	T1-B
Tool break detection	When a tool is commanded for broken tool check, automatic operations will bring the tool in contact with the table mounted touch sensor. If the tool tip does not make contact with the sensor at the designated offset length the tool is determined to be broken.      This checking command can be put into the machining program at any point.      Applicable tools: Drills and taps     Details of the movement when tool break is detected depend on the specifications of the machine main unit.	1 11-6	

 $<sup>^{\</sup>star}$ Adding the TO software enables also the manual measurement. Please refer to "TO software [Opt]" on the page 29.


#### Tool length measurement and Tool breakage detection

A tool in the tool magazine is called up to the spindle, and length of the tool is measured automatically and registered automatically as data of the tool length in respective offset number. After the tool is used in machining, the tool can be checked for breakage automatically. If the tool is detected as damaged, the machine issues an alarm and stops operating.



#### Tool breakage detection in tool magazine [Another Opt]

This function enables detecting tool breakage in the tool magazine while the machine is in the automatic operation.

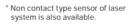



#### — Type of sensor



#### [OMP60] Renishaw

Use the optical signal transfer method. The signal receiver block is not needed since signals are sent and received by using infrared rays. The signal receiver module can be fitted on inside wall of splash guard.



[RMP60] Renishaw

Use the radio signal transfer method. It is suitable for the machines having long distance for signal transfer from the sensor to the receiver such as the large models and 5-axis machining centers.



[MP700] Renishaw

With a low and consistent trigger force in all sensing directions, the MP700 is ideal for complex and contoured part inspection.




[TC50] Blum


The multidirectional touch probe TC50 allows fast, precise and automatic determination of workpiece position and workpiece dimensions in machining centers.

#### Manual measurement with software of touch sensor system TO

A sensor is moved to the desired measuring position by operating a manual handle. The machine starts measuring automatically when the sensor comes into contact with a workpiece, and results of the measurement are reflected in the settings of desired work coordinate system and tool offset number through a simple operation.



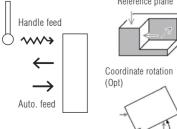

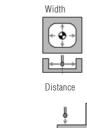



#### Hydraulic and compressed air supply ports for fixture [Opt]

#### Rotary joint on pallet system (Example 1)



Example of the use of 6-port rotary joint (HM400/500S, HM5100/HM6000S)

## Supply from above the fixture: Hydraulic or air pressure can be applied to the clamping device constantly so that the workpiece clamping device is prevented from getting loose during machining. However, height of the fixture is limited due to a rotary joint and its piping installed above the fixture.

4471

The pallet-through method is simple and does not require a rotary joint and its piping above the fixture. However, the clamp/unclamp function is available only in the setup station. (Hydraulic pressure and air pressure are not supplied after moving to the machining position.)

○Avaiable × Not avaiable

	Rotary joint on pallet system	pallet through
HM400/HM500S	0	0
HM5100/HM6000S	0	$\circ$
HM630/HM800S	0	×
HM800/HM1000S	0	0
HM1000/HM1250S	0	0

Note1: The pallet-through system allows the clamping operations of the fixtures only in the work setup station.

Note2: Availability is depends on the supply source (hydraulic or air), pressure, number of ports and other specification.

#### Rotary joint on pallet system (Example 2)




#### Pallet through system (Use auto-coupler)





Pallet through system (Use auto-coupler)

#### Fixture example



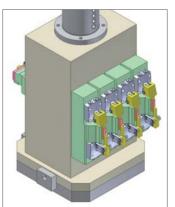

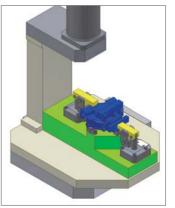


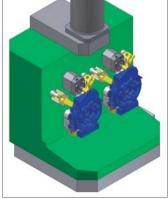


#### Multiple-pallet APC [Opt]

#### HM400/HM500S




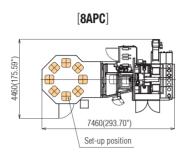


#### HM5100/HM6000S

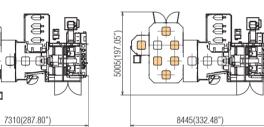

#### [6-pallet with set-up station (pattern 1)] [6-pallet with set-up station (pattern 2)] [8-pallet with set-up station (pattern 2)]

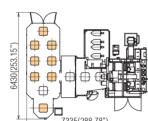

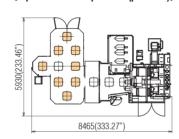

#### HM630/HM800S




HM630 6-pallet APC (Horizontal type) Photo is taken without safety cover.




HM1000 6-pallet APC (Horizontal type) Photo is taken without safety cover.


#### [6-pallet vertical type with set-up station]

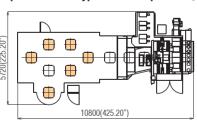


[8-pallet vertical type with set-up station]

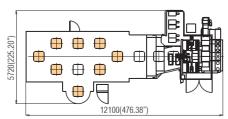

[6-pallet horizontal type with set-up station]

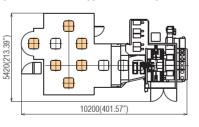


[8-pallet horizontal type with set-up station]

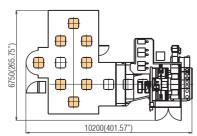


#### HM800/HM1000S


#### [6-pallet vertical type with set-up station]

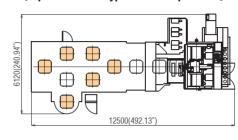


[8-pallet vertical type with set-up station]

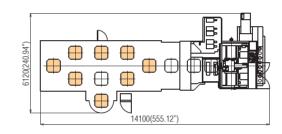

#### [6-pallet horizontal type with set-up station]

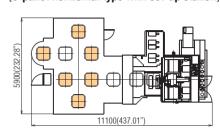


#### [8-pallet horizontal type with set-up station]

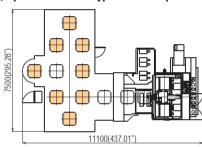


#### HM1000/HM1250S


#### [6-pallet horizontal type with set-up station]

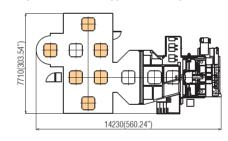

#### [6-pallet vertical type with set-up station]

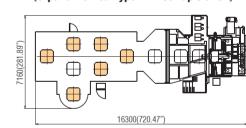

#### Auto restart function [Another Opt]

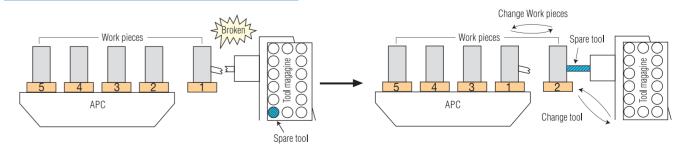


When a tool failure detected by a tool breakage detection system such as soft CCM, touch sensor system T1-C or others, automatic restart stops the machine and interrupts processing. The system will exchange the broken tool with an available spare tool then will either execute an APC or program end command.

#### **OKK's exclusive control functions**


#### Programming support functions

#### Program Editor [F31i-B]

Program editor allows you to edit programs stored in NC memory, from a data server (or hard disc) or memory card.

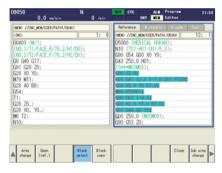

- Two programs can be displayed side by side.
- Characters in the program can be converted all at once. (Example: Changes F1000 to F1200.)
- Multiple-line data can be copied from other programs with ease.

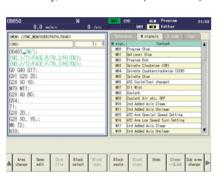

■ By switching the right-side screen for reference use, a list of M signals/G codes and information on tools in the magazine can be displayed.



- Programs can be copied or deleted and program names can be changed easily with the Program
- The Program Editor's multiple-file batch copy function enables to make a backup of the programs in the NC memory or hard disc easily with a memory card.

#### Setup support functions


#### Tool Support [F31i-B]

Now through a single set-up screen the tools number, description, schematic, and geometry are displayed. You can also perform the tool change commands and measurement cycle at the same set-up screen.

#### Tool setup screen




#### **Tool length compensation amount** measurement screen

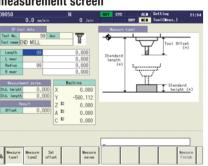

#### T0 software [Opt]

This screen enables the simple manual measurement using the touch sensor (option: T1-A or T1-B). You can move the sensor to the desired measuring point by handle mode then the machine starts the automatic measurement after the sensor contacts the workpiece. You can set the results of the measurement as the data for the desired workpiece coordinate system and tool offset number through the single key operation.

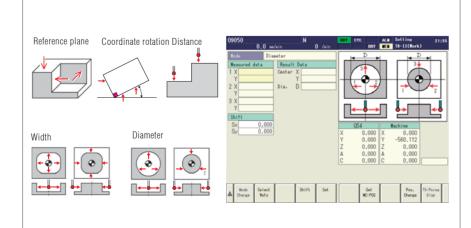

#### Maintenance functions

#### Help Guidance [F31i-B]

The screen will display detailed information regarding the machine alarm and will explain how to recover the machine from the problem. This screen will also display a list of G-codes and a description of M signals.

#### Display of details of alarms



#### **Description of M signals**



#### High-efficiency Control Technologies

#### Hyper HQ Control [Opt]

High-speed processing is enabled by improved capability of processing fine line segment toolpaths.

17777

#### F31i-B/FAi capability of processing fine line segments

Type		rta processing speed min)	Instruction method
,,	F31i-B	FAi	
Without Hyper HQ control	15 (59	1 ipm)	
Hyper HQ control mode A	30 (118	31 ipm)	ON: G05.1Q1; OFF: G05.1Q0
Hyper HQ control mode B	150 (5906 ipm)	_	ON: G05.1Q1; OFF: G05.1Q0

The above values show (theoretical) maximum speeds for processing 1-mm-segment blocks constructing a straight line. Actual processing speeds depend on the type of the machine and NC data.

#### **HQ Tuner [Opt]**

The HQ tuner provides the programmer a 10-step adjustment of parameters for hyper HQ control in accordance with processing conditions.

It adjusts the hyper HQ control in accordance with the current process.

For example, during roughing routines the programmer can place a higher priority on speed and in finishing routines a higher priority on dimensional accuracy at corners and circular arcs.



#### Technologies for Reduced Setup and Unmanned Operation

#### Soft AC [Opt]

The soft AC function applies the feed rate override control automatically so that the value of the spindle load meter does not change significantly. This helps to prevent damages of tools caused by overload and improve cutting efficiency.

- Adaptive control function Feed override control range: 10 to 200% (Changeable with parameters) Alarms are output at the lower limit override value.
- Air-cut reduction function Feed rates during non-cutting operation can be increased up to 200%. (Changeable with parameters)
- Tool failure monitoring function Specifications similar to the soft CCM.
- Continuous unmanned machining at the time of tool failure (option) Combined operation with the automatic restart function is possible.

#### Soft CCM [Opt]

The Soft CCM monitors the spindle load meter, and stops operation when the meter value exceeds the preset value (set by M signal or set for each of the T numbers through setting screen) and generation of abnormal tool load is determined which is convenient for unmanned operation at night.

#### High-efficiency Control Technologies

#### Data Server [Opt]

A large amount of machining programs can be transferred to the data server through the network connected to the host computer at high speed. The transferred machining programs are executed as the main programs or sub-programs (called up by using the M198 signal.)



30

FANUC Controller F31i-B (Windows CE-installed Open CNC)

Standard Specification
No. of controlled axes: 4 axes (X, Y, Z, B)
No. of simultaneously controlled axes: 3 axes (4 axes for BRT specification)
Least input increment: 0.001mm / 0.0001"
Max.programmable dimension: ±999999.999mm / ±39370.0787"
Absolute / Incremental command: G90 / G91
Decimal point input / Pocket calculator type decimal point input
Inch / Metric conversion: G20 / G21
Program code: ISO / EIA automatic discriminaton
Program format: FANUC standard format
Nano interpolation (internal)
Positioning: G00
Linear interpolation: G01
Circular interpolation: G02 / G03 (CW / CCW), including radius designation
Cutting feed rate: 6.3-digit F-code, direct command
Dwell: G04
Manual handle feed: manual pulse generator 1 set(0.001, 0.01, 0.1mm)
Rapid traverse override: 0 / 1 / 10 / 25 / 50 / 100%
Cutting feed rate override: 0 to 200% (every 10%)
Feed rate override cancel: M49 / M48
Rigid tapping: G84, G74 (Mode designation: M29)
Part program storage capacity: 160m [64KB]
No. of registered programs: 120
Part program editing
Background editing
Extended part program editing
10.4" color LCD
Clock function
MDI (Manual Data Input) operation
Memory card interface
Spindle function: 5-digit S-code direct command
Spindle speed override: 50 to 150% (every 5%)
Tool function: 4-digit T-code direct command
ATC tool registration
Auxiliary function: 3-digit M-code programming
Multiple M-codes in 1 block: 3 codes (Max. 20 settings
Tool length offset: G43, G44/G49
Tool diameter and cutting edge R compensation: G41, G42/G40
Tool offset sets: 99 sets in total
Tool offset memory C
Manual reference position return
Automatic reference position return: G28/G29
2nd reference position return: G30
Reference position return check: G27
Automatic coordinate system setting
Coordinate system setting: G92
Machine coordinate system: G53
Workpiece coordinate system: G54 to G59
Tompleto occidinate cyclein. Got to Goo
Local coordinate system: G52
Local coordinate system: G52
Local coordinate system: G52 Program stop: M00
Local coordinate system: G52 Program stop: M00 Optional stop: M01
Local coordinate system: G52 Program stop: M00 Optional stop: M01 Optional block skip: /
Local coordinate system: G52 Program stop: M00 Optional stop: M01 Optional block skip: / Dry run
Local coordinate system: G52 Program stop: M00 Optional stop: M01 Optional block skip: /
Local coordinate system: G52 Program stop: M00 Optional stop: M01 Optional block skip: / Dry run Machine lock Z-axis feed cancel
Local coordinate system: G52 Program stop: M00 Optional stop: M01 Optional block skip: / Dry run Machine lock Z-axis feed cancel Auxiliary function lock
Local coordinate system: G52 Program stop: M00 Optional stop: M01 Optional block skip: / Dry run Machine lock Z-axis feed cancel

Sequence number search

Standard Specification
Program restart
Cycle start
Auto restart
Single block
Feed hold
Manual absolute on/off: parameter
Sub program control
Canned cycle: G73, G74, G76, G80 to G89
Mirror image function: parameter
Automatic corner override
Exact stop check/mode
Programmable data input: G10
Backlash compensation for each rapid traverse and cutting feed
Smooth backlash compensation
Memory pitch error compensation (interpolation type)
Skip function
Tool length manual measurement
Emergency stop
Data protection key
NC alarm display / alarm history display
Machine alarm display
Stored stroke limit 1
Stored stroke limit 2, 3
Load monitor
Self-diagnosis
Absolute position detection
Manual guide i (Basic)
Optional Specification
15" color LCD
Additional one axis control: name of axis(A, B, C, U, V, W)
Additional true areas and all areas of article D. O. H. M. MO.

Absolute position detection	
Manual guide i (Basic)	
Optional Specification	
15" color LCD	
Additional one axis control: name of axis(A, B, C, U, V, W)	*
Additional two axes control: name of axis(A, B, C, U, V, W)	*
No. of simultaneously controlled axes: 5 axes	*
Least input increment: 0.0001mm / 0.00001"	
FS15 tape format	
Unidirectional positioning: G60	
Helical interpolation	PK1
Cylindrical interpolation	
Hypothetical axis interpolation	
Spiral/Conical interpolation	
Smooth interpolation (Hyper HQ control B mode is required)	
NURBS interpolation (Hyper HQ control B mode is required)	
Involute interpolation	
One-digit F code feed	
Handle feed 3 axes(Standard pulse handle is removed)	
Part program storage capacity: 320m[128KB] (250 in total)	
Part program storage capacity: 640m [256KB] (500 in total)	
Part program storage capacity: 1280m[512KB](1000 in total)	PK1
Part program storage capacity: 2560m [1MB] (1000 in total)	
Part program storage capacity: 5120m [2MB] (1000 in total)	
Part program storage capacity: 10240m[4MB](1000 in total)	
Part program storage capacity: 20480m[8MB](1000 in total)	
RS232C interface: RS232C-1CH	

Data server: ATA card (1GB)

Data server: ATA card (4GB)

3-dimensional cutter compensation

Tool position offset

Spindle contour control (Cs contour control)

Optional Specification  Tool offset sets: 200 sets in total	PK1
Tool offset sets: 400 sets in total	FKI
Tool offset sets: 499 sets in total	
Tool offset sets: 999 sets in total	
Addition of workpiece coordinate system (48 sets in total): G54.1 P1 to P48	PK1
Addition of workpiece coordinate system (300 sets in total): G54.1 P1 to P300	1 1(1
Machining time stamp	
Addition of optional block skip: 9 in total	
Tool retract and return	
Sequence number comparison and stop	
Manual handle interruption	
Programmable mirror image	PK1
Optional chamfering / corner R	
Custom macro	PK1
Interruption type custom macro	
Addition of custom macro common variables: 600	
Figure copy	
Coordinate system rotation: G68, G69	
Scaling: G50, G51	
Chopping (Axis control by PMC)	
Playback	
Tool life management: 256 sets in total	PK1
Addition of tool life management sets: 1024 sets in total	
High-speed skip	
Run hour and parts count display	PK1
Manual guide i (Milling cycle)	

Original OKK Software	
Machining support integrated software (including Help guidance,	etc.) STD
Tool support	STD
Program editor	STD
EasyPRO	STD
Work manager	0P
HQ control	STD
Hyper HQ control mode A	OP
Hyper HQ control mode B	PK2 OP
Hyper HQ value kit (including the items with "PK2")	OP
NC option package (including the items with "PK1")	0P
Special canned cycle (including circular cutting)	0P
Cycle mate F	0P
Soft scale IIm	STD
Touch sensor TO software	0P
Tool failure detection system (Soft CCM)	OP
Adaptive control (Soft AC)	0P
Automatic restart at tool damage	0P

#### \*F31i-B5 (Windows CE-installed Open CNC) controller is required STD: Standard OP: Option

#### **FANUC Controller FAi**

	Standard Specification
	No. of controlled axes: 4 axes (X, Y, Z, B)
	No. of simultaneously controlled axes: 3 axes (4 axes for BRT specification)
	Least input increment: 0.001mm / 0.0001"
	Max.programmable dimension: ±999999.999mm / ±39370.0787"
1	Absolute / Incremental command: G90 / G91
	Decimal point input / Pocket calculator type decimal point input
	Inch / Metric conversion: G20 / G21
	Program code: ISO / EIA automatic discriminaton
	Program format: FANUC standard format
	Nano interpolation(internal)
	Positioning: G00
	Linear interpolation: G01
	Circular interpolation: G02 / G03 (CW / CCW), including radius designation Unidirectional positioning: G60
	Helical interpolation
	Cylindrical interpolation
	Cutting feed rate: 6.3-digit F-code, direct command
	Dwell: G04
	Manual handle feed: manual pulse generator 1 set (0.001, 0.01, 0.1mm)
	Rapid traverse override: 0 / 1 / 10 / 25 / 50 / 100%
	Cutting feed rate override: 0 to 200% (every 10%)
	Feed rate override cancel: M49 / M48
ı	Rigid tapping: G84, G74 (Mode designation: M29)
	One-digit F code feed
	Inverse time feed
	Part program storage capacity: 1280m [512KB]
	No. of registered programs: 400
	Part program editing
	Background editing
	Extended part program editing
	10.4" color LCD
	Clock function
	MDI(Manual Data Input) operation
	Run hour and parts count display Memory card interface
	Spindle function: 5-digit S-code direct command
	Spindle speed override: 50 to 150% (every 5%)
	Tool function: 4-digit T-code direct command
	ATC tool registration
	Auxiliary function: 3-digit M-code programming
	Multiple M-codes in 1 block: 3 codes (Max. 20 settings)
	Tool length offset: G43, G44/G49
	Tool diameter and cutting edge R compensation: G41, G42/G40
	Tool offset sets: 400 sets in total
	Tool offset memory C
	Tool position offset
I	Manual reference position return
	Automatic reference position return: G28/G29
	2nd reference position return: G30
	Reference position return check: G27
	Automatic coordinate system setting
	Coordinate system setting: G92
	Machine coordinate system: G53
	Workpiece coordinate system: G54 to G59
	Local coordinate system: G52
į	Addition of workpiece coordinate system (48 sets in total): G54.1 P1 to P48

Standard Specific	ation
Optional block skip: /	
Addition of optional block skip: 9 in to	tal
Dry run	
Machine lock	
Z-axis feed cancel	
Auxiliary function lock	
Graphic display	
Program number search	
Sequence number search	
Program restart	
Cycle start	
Auto restart	
Single block	
Feed hold	
Manual absolute on/off: parameter	
Sequence number comparison and sto	op .
Manual handle interruption	
Sub program control	
Canned cycle: G73, G74, G76, G80 to	G89
Mirror image function: parameter	
Automatic corner override	
Exact stop check/mode	
Programmable data input: G10	
Scaling: G50, G51	
Custom macro	
Interruption type custom macro	ariables: 600
Addition of custom macro common va	ariables: 600
Programmable mirror image	
Coordinate system rotation: G68, G69 Optional chamfering / corner R	
Manual guide i (Basic)	
Backlash compensation for each rapid to	raverse and outting food
Memory pitch error compensation	avorse and culling leed
Skip function	
Tool length manual measurement	
Tool life management: 128 sets in tota	al
Emergency stop	
Data protection key	
NC alarm display / alarm history displa	av
Machine alarm display	~,
Stored stroke limit 1	
Stored stroke limit 2, 3	
Load monitor	
Self-diagnosis	
Absolute position detection	
Alboorato position dotootion	

**Optional Specification** Additional one axis control: name of axis (A, C, U, V, W) (No. of simultaneously controlled axes: 4 axes) Additional two axes control: name of axis (A, C, U, V, W) (No. of simultaneously controlled axes: 4 axes)

Part program storage capacity: 5120m [2MB] (400 in total)

FS11 tape format

High-speed skip

Data server: ATA card (1GB)

Manual guide i (Milling cycle)

RS232C interface: RS232C-1CH

Original OKK Software	
HQ control	STD
Hyper HQ control mode A	0P
Soft scale IIm	STD
Special canned cycle (including circular cutting)	0P
Touch sensor T0 software	0P
Tool failure detection system (Soft CCM)	0P
Adaptive control (Soft AC)	OP
Automatic restart at tool damage	0P

27777

Spindle contour control (Cs contour control)


STD: Standard OP: Option

Item		HM400/40	HM500S/40	HM400/50	HM500S/50
Travel on X axis (Column: right/left)	mm		630 (2	4.80")	
Travel on Y axis (Spindle head: up/down)	mm	620 (24.41")			
Travel on Z axis (Table: back/forth)	mm		710 (2	7.95")	
Distance from table top surface to spindle center	mm	80~700 (3.15"~27.55")	50~670 (1.97"~26.38")	80~700 (3.15"~27.55")	50~670 (1.97"~26.38")
Distance from table center to spindle nose	mm		150~860(5.9	91"~33.86")	
Pallet work surface area	mm	400 (15.75")	□500 (19.69°)	□400 (15.75°)	□500 (19.69")
Max. weight loadable on pallet	kg		(Uniform load)	450 (992lbs)	1
Pallet top surface configuration			25×M	16tap	
Minimum indexable angle of table	deg		BRT 0.001 /	' IT[Opt] 1*1	
Table index time (for indexing 90 degrees)	sec		BRT 0.5 / I	T[Opt] 1.9	
Spindle speed	min <sup>-1</sup>	35~1	10,000	35~1	2,000
Number of spindle speed change steps			Electric 2-step sp	eed change (MS)	
Spindle inner taper		7/24 tap	per, No.40	7/24 tap	er, No.50
Spindle bearing inner diameter	mm	ø80 (	(3.15")	ø100	3.94")
Rapid traverse rate	m/min		54 (2,12	26 ipm)	
Cutting feed rate	mm/min		1~40,000 (0.04	4~1574 ipm)*2	
Type of tool shank		JIS B 6	339 BT40	JIS B 63	39 BT50
Type of pull stud		MAS403 P4	10T-1 (MASI)	OKK o	nly 90°
Tool storage capacity	tool		40	<b>*</b> 3	
Maximum tool diameter	mm	ø82 (3.23") / ø160 (6.30")	without tool in adjacent pot	ø115 (4.53") / ø250 (9.84")	without tool in adjacent pot
Maximum tool length (from the gauge line)	mm	400 (15.75")			
Maximum tool weight	kg	12 (26 lbs) with	h slow ATC cycle	25 (55 lbs) with	slow ATC cycle
Maximum tool moment	N·m	9.8 (7.3	2 ft · lbs)	29.4 (21.	7 ft · lbs)
Tool selection method			Address fixed r	random system	
Tool change time (cut-to-cut)	sec	3	3.3	4	.2
Pallet change method			Direc	t turn	
Pallet change time (JIS evaluation time)	sec		9.	5	
Spindle motor	AC, kW	,	HP)/26 (35HP) / 0/30min/cont. rating)	FANUC 30 25 (34HP) (30n	\ /·
Feed motor (X,Y,Z,B)	kW	FANUC 5.5 (7.	4HP) / 5.5 (7.4HP) / 4.5 (6.0H	HP) /BRT: 4.5 (6.0HP) (IT[Op	t]: 4.5 (6.0HP))
Hydraulic pump motor	kW		1.5 (2	.0HP)	
Motor of oil cooler for spindle and feed system(compression/discharge)	kW		1.1 (1.5HP) /	/ 0.4 (0.5HP)	
Coolant pump motor	kW	50Hz: 0.7 (0.9HP) 60Hz: 1.2 (1.6HP)			
Power supply AC200V±10% 50/60±1Hz AC220V±10% 60±1Hz*4	kVA	FANUC 56 FANUC 62		IC 62	
Compressed air supply	MPa, <i>l</i> /min [ANR]		0.4~0.6*5, 500*6(58~	-87 psi, 132 gal/min)	
Hydraulic unit tank capacity	l		20 (5.	3 gal)	
Spindle and feed system cooling oil tank capacity	l	20 (5.3gal)			
Coolant tank capacity	l		480 (12	27 gal)	
Machine height	mm	2844 (	111.97")	2970 (1	16.93")
Required floor space	mm		Refer to the floor	space drawing.	
Machine weight	kg	12,000 (26,455 lbs)	12,200 (26,896 lbs)	12,500 (27,557 lbs)	12,700 (27,998 lbs)
Operating environment temperature	°C		5~	40	


- \*1 BRT: Built-in rotary table minimum indexing 0.001° IT: Index table minimum indexing 1°
- \*2 Available under the HQ or hyper HQ control.
- \*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.
- \*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.
- \*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
- \*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supplyrequirement.


#### **Machine Dimensions** mm(in)

#### Floor Space [ ]: Dimensions of HM400/50 and HM500S/50 Hydraulic unit (installed separately) Oil cooler \(installed separately) [<mark>900(35.43)]</mark> 700(27.56") 4255(167.52")[4355(171.46")] 5225(205.71")[5425(213.58")]

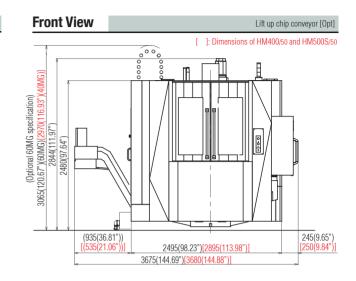


#### **Pallet Dimensions**

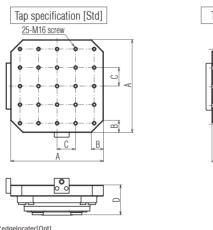


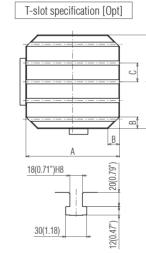


allet dimensions mm(in)						
	А	В	С	D		
HM400	400(15.8")	50(1.97")	80(3.15")	130(5.12")		
HM500S	500(19.7")	65(2.56")	100(3.94")	160(6.30")		
HM400(T-slot)	400(15.8")	50(1.97")	80(3.15")	160(6.30")		
IM500S(T-slot)	500(19.7")	65(2.56")	100(3.94")	190(7.48")		

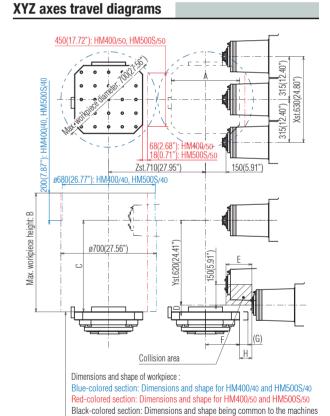

#### **Restriction on Tool**

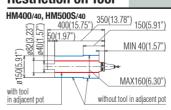

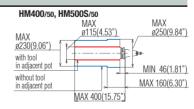


XYZ axis travel diagrams mm(i								mm(in)
	А	В	С	D	E	F	G	Н
HM400	400(15.75")	900(35.43")	700(27.56")	80(3.15")	160(6.30")	200(7.87")	50(1.97")	110(4.33")
HM500S	500(19.69")	870(34.25")	670(26.38")	50(1.97")	190(7.48")	250(9.84")	61(2.40")	90(3.54")
HM400(T-slot)	400(15.75")	870(34.25")	670(26.38")	50(1.97")	160(6.30")	200(7.87")	50(1.97")	110(4.33")
HM500S(T-slot)	500(19.69")	840(33.07")	640(25.20")	20(0.79")	190(7.48")	250(9.84")	61(2.40")	90(3.54")


Item		HM5100 HM60005			
Travel on X axis (Column: right/left)	mm	800 (31.50")			
Travel on Y axis (Spindle head: up/down)	mm	750 (29.53")			
Travel on Z axis (Table: back/forth)	mm	880 (34.65")			
Distance from table top surface to spindle center	mm	80~830 (3.15"~32.68") 50~800 (1.96"~31.50")			
Distance from table center to spindle nose	mm	70~950 (2.76"~37.40")			
Pallet work surface area	mm	□500 (19.69") □630 (24.80")			
Max. weight loadable on pallet	kg	(Uniform load) 800 (1763 lbs) (Uniform load) 700 (1543 lbs)			
Pallet top surface configuration		24×M16tap			
Minimum indexable angle of table	٥	BRT 0.001 / IT [Opt] 1*1			
Table index time (for indexing 90 degrees)	sec	BRT 0.5 / IT [Opt] 1.7			
Spindle speed	min <sup>-1</sup>	35~12,000			
Number of spindle speed change steps		Electric 2-step speed change (MS)			
Spindle inner taper		7/24 taper, No.50			
Spindle bearing inner diameter	mm	ø100 (3.94")			
Rapid traverse rate	m/min	X,Z: 75 (2,953 ipm) Y: 60 (2,362 ipm)			
Cutting feed rate	mm/min	1~40,000 (0.04~1574 ipm)*2			
Type of tool shank		JIS B 6339 BT50			
Type of pull stud		OKK only 90°			
Tool storage capacity	tool	60*3			
Maximum tool diameter	mm	ø115 (4.53") / ø300 (11.81") without tool in adjacent pots			
Maximum tool length (from the gauge line)	mm	600 (23.62")			
Maximum tool weight	kg	When turning at normal speed: 10; When slow turning is selected: 30			
Maximum tool moment	N·m	29.4 (21.68 ft · lbs)			
Tool selection method		Address fixed random system			
Tool change time (cut-to-cut)	Sec	3.7			
Pallet change method		Direct turn			
Pallet change time (JIS evaluation time)	Sec	10.5			
Spindle motor (25%ED/30min/cont. rating)	AC, kW	FANUC 45 (60HP) / 30 (40HP) / 26 (35HP)			
Motor for ATC (Automatic Tool Changer)	kW	1.5 (2HP)			
Feed motor (X,Y,Z,B)	kW	FANUC 5.5 (7.4HP) / 5.5 (7.4HP) / 5.5 (7.4HP) / BRT: 4.5 (6.0HP) (IT[Opt]: 1.6 (2.1HP))			
Hydraulic pump motor	kW	1.5 (2HP)			
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.1 (1.5HP) / 0.4 (0.5HP)			
Coolant pump motor	kW	50Hz: 0.7 (0.9HP) 60Hz: 1.2 (1.6HP)			
Power supply AC200V±10% 50/60±1Hz AC220V±10% 60±1Hz*4	kVA	FANUC 58			
Compressed air supply	MPa, ℓ/min [ANR]				
Hydraulic unit tank capacity	l l	20 (5.3 gal)			
Spindle and feed system cooling oil tank capacity	l	20 (5.3 gal)			
Magazine lubricating oil tank capacity	l	4.2 (0.3 gal)			
Coolant tank capacity	l	720 (190 gal) (Option for the lift up type chip conveyor specification)			
Machine height	mm	4115 (162.01")			
Required floor space	mm	3,655×5,380 (143.90"×211.81") (Option for the lift up type chip conveyor specification)			
Machine weight	kg	15,700 (34,612 lbs) 16,000 (35,273 lbs)			
Operating environment temperature	°C	5~40			
operating environment temperature	U	0 10			

- \*1 BRT: Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°
- \*2 Available under the HQ or hyper HQ control.
- \*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.
- 4 When the supply voltage is 220/VAC, the supply frequency of 60Hz only is applicable.
   5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
- \*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.

#### **Machine Dimensions** mm(in)


#### Floor Space

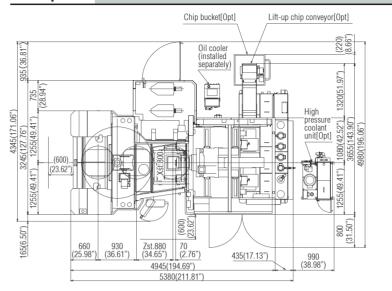

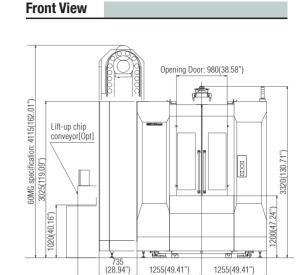

3245(127.76")

#### **Pallet Dimensions**

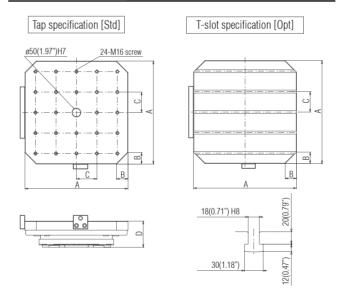

Pallet dimensions mm(i								
	А	В	С	D				
HM5100	500(19.69")	60(2.36")	100(3.94")	130(5.12")				
HM6000S   630(24.80")   70(2.76")   125(4.92")   160(6.30")								
Notes: Tap and T-slot are same dimensions.								


XYZ axis travel diagrams mn								
	А	В	С	D	Е			
HM5100	500(19.69")	1330(52.36")	830(32.68")	80(3.15")	271(10.67")*1			
HM6000S	630(24.8")	1300(51.18")	800(31.5")	50(1.97")	336(13.23")*			

<sup>\*1</sup> At B-axis rotated 0°/90°/180°/270°: 250mm (9.84"). \*2 At B-axis rotated 0°/90°/180°/270°: 315mm (12.40").


Notes: Tap and T-slot are same dimensions

#### **Restriction on Tool**

410(16.14")

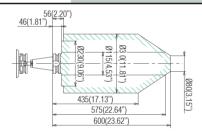

#### XYZ axes travel diagrams

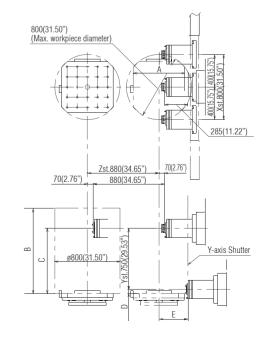

Item		HM630	LIMBOOF		
			HM8005		
Travel on X axis (Column: right/left)	mm		41.34")		
Travel on Y axis (Spindle head: up/down)	mm	900 (35.43")			
Travel on Z axis (Table: back/forth)	mm	900 (35.43")	880 (34.65")		
Distance from pallet top surface to spindle center	mm	80~980 (3.15"~38.58")	60-960 (2.36"~37.80")		
Distance from pallet center to spindle nose	mm	200~1100 (7.87"~43.31")	220~1100 (8.66"~43.31")		
Pallet work surface area	mm	630 (24.80°)	800 (31.50")		
Max. weight loadable on pallet	kg	(Uniform load) 1300 (2866 lbs)	(Uniform load) 1200 (2645 lbs)		
Pallet top surface configuration		24xM	16 tap		
Minimum indexable angle of table	٥	BRT 0.001 /	'IT [Opt] 1*1		
Table index time (for indexing 90 degrees)	Sec	BRT 0.6 / I	T [Opt] 1.7		
Spindle speed	min <sup>-1</sup>	35~1	2,000		
Number of spindle speed change steps		Electric 2-step sp	eed change (MS)		
Spindle inner taper		7/24 tap	er, No.50		
Spindle bearing inner diameter	mm	ø100 (	(3.94")		
Rapid traverse rate	m/min	54 (2,1	26 ipm)		
Cutting feed rate	mm/min	1~40,000 (0.0	4~1574 ipm)* <sup>2</sup>		
Type of tool shank		JIS B 63	39 BT50		
Type of pull stud		OKK o	nly 90°		
Tool storage capacity	tool	40	)*3		
Maximum tool diameter	mm	ø115 (4.53") / ø270 (10.63")	without tool in adjacent pots		
Maximum tool length (from the gauge line)	mm	500 (19.69")			
Maximum tool weight	kg	25 (55 lbs)			
Maximum tool moment		29.4 (21.7 ft · lbs)			
Tool selection method		Address fixed	random system		
Tool change time (cut-to-cut)	sec	4	.4		
Pallet change method		Direc	t turn		
Pallet change time (JIS evaluation time)	sec	15	5.0		
spindle motor (25%ED/30min/cont. rating)	AC, kW	FANUC 45 (60HP) / 3	0 (40HP) / 26 (35HP)		
Motor for tool clamp/unclamp unit	kW	0.75 (	1.0HP)		
Feed motor (X, Y, Z, B)	kW	FANUC 5.5 (7.4HP) / 5.5 (7.4HP) / 5.5(7.4H	IP) / BRT: 4.5 (6.0HP) (IT[Opt]: 2.7 (3.6HP))		
Hydraulic pump motor	kW	1.5 (2	2.0HP)		
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.7(2.3 HP) /	0.75 (1.0 HP)		
Coolant pump motor	kW	50Hz: 0.7 (0.9HP)	60Hz: 1.2 (1.6HP)		
Motor for APC unit	kW	0.75 (	1.0 HP)		
Power supply 200VAC ±10% 50/60 ±1Hz 220VAC ±10% 60 ±1Hz <sup>-4</sup>	kVA	FANU	JC 65		
Compressed air supply	MPa, <i>l</i> /min [ANR]	0.4~0.6*5, 500*6 (58	~87 psi, 132 gal/min)		
Hydraulic unit tank capacity	l	20 (5.	3 gal)		
Spindle and feed system cooling oil tank capacity	l	70 (18	i.5 gal)		
Magazine lubricating oil tank capacity	l	1 (0.	3 gal)		
Coolant tank capacity	l	400 (1	06 gal)		
Machine height	mm	3,430 (	135.04")		
Required floor space	mm	3,420x5,450 (1:	34.65"x214.57")		
Machine weight	kg	18,000 (39700 lbs)	18,500 (40800 lbs)		
Operating environment temperature	°C	5~	40		

- \*1 BRT: Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°
- \*2 Available under the HQ or hyper HQ control.
- \*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.


- \*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.

  \*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.

  \*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.


#### **Dimentions** mm(in)

#### Floor Space

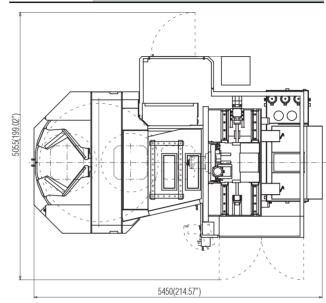


## **Front View** onal 75-m/min rapid traverse rate specification)3796(149.45" 3430(135.04") 3670(144.49")

#### **Pallet Dimensions**

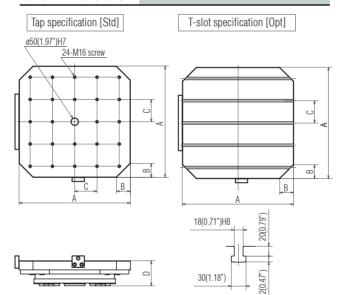

#### XYZ axes travel diagrams

(Note 1)
For executing the APC operation, the loaded workpiece must not exceed the specified maximum APC turning diameter.

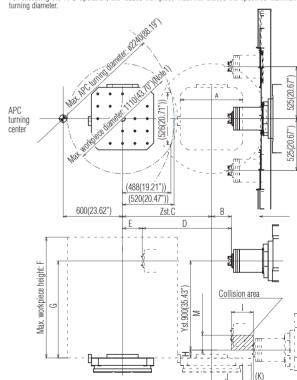

#### **Restriction on Tool**

Pallet dime		mm(in)			
	A	В	С	D	
HM630	630(24.8")	70(2.76")	125(4.92	160(6.30")	
HM800S	800(31.5")	100(3.94")	160(6.30")	180(7.09")	
HM800S(T-slot) 800(31.50") 100(3.94") 160(6.30") 200(7.87"					

1)	MAX +	MAX ø115(4.53")	MAX ø230(9.06")
") ")	with tool in adjacent pot	1	MIN 46(1.81")
<u>')</u>	without tool in adjacent pot	MAX 500(19.69	MIN 56(2.20")

	M
axis travel diagrams	TAT
axio ilavti ulaylallio	

XYZ axis tr	MAX 200(19.	MVV 200(13'03 )											
	А	В	С	D	Е	F	G	Н	I	J	K	L	M
HM630	630(24.8")	200(7.87")	900(35.43")	900(35.43")	200(7.87")	1220(48.03")	980(38.58")	80(3.15")	220(8.66")	315(12.4")	84(3.31")	105(4.13")	150(5.91")
HM800S	800(31.5")	220(8.66")	880(34.65")	880(34.65")	220(8.66")	1200(47.24")	960(37.80")	60(2.36")	300(11.81")	400(15.75")	100(3.94")	120(4.72")	150(5.91")
HM800S(T-slot)	800(31.50")	220(8.66")	880(34.65")	880(34.65")	220(8.66")	1180(46.46")	940(37.01")	40(1.57")	300(11.81")	400(15.75")	100(3.94")	120(4.72")	170(6.69")

HM630: Tap and T-slot are same dimensions.

Item		HM800	HMIOOOS				
Travel on X axis (Column: right/left)	mm	1400 (55					
Travel on Y axis (Spindle head: up/down)	mm	1100 (43	,				
Travel on Z axis (Table: back/forth)	mm	1050 (41.34")	1000 (39.37")				
Distance from pallet top surface to spindle center	mm	60~1160 (2.36"~45.67")	30~1130 (1.18"~44.49")				
Distance from pallet center to spindle nose	mm	200~1250 (7.87"~49.21")	250~1250 (9.84"~49.21")				
Pallet work surface area	mm	800 (31.50°)	□ 1000 (39.37")				
Max. weight loadable on pallet	kg	(Uniform load) 2000 (4400 lbs)	(Uniform load) 2500 (5500 lbs)				
Pallet top surface configuration	ng	24xM16	, , , , ,				
Minimum indexable angle of table	0	IT 1/ BRT [Or	·				
Table index time (for indexing 90 degrees)	sec	IT 4.5 / BRT [Opt] 1.2	IT 5.5 / BRT [Opt] 1.2				
Spindle speed	min <sup>-1</sup>	35~8,0					
Number of spindle speed change steps		Electric 2-step spec					
Spindle inner taper		7/24 taper,					
Spindle bearing inner diameter	mm	ø100 (3.					
Rapid traverse rate	m/min	48 (1,889	·				
Cutting feed rate	mm/min	1~40,000 (0.04-					
Type of tool shank	,	JIS B 6339	. ,				
Type of pull stud		OKK only					
Tool storage capacity	tool	40*3					
Maximum tool diameter	mm	ø115 (4.53") / ø270 (10.63") without tool in adjacent pots					
Maximum tool length (from the gauge line)	mm	500 (19.					
Maximum tool weight	kg	25 (55)	,				
Maximum tool moment	g	29.4 (21.7	·				
Tool selection method		Address fixed rai	,				
Tool change time (cut-to-cut)	sec	5.8	•				
Pallet change method		Direct t					
Pallet change time (JIS evaluation time)	sec	19.0	21.0				
spindle motor (30min/cont. rating)	AC, kW	FANUC 30 (40HP	P) / 25 (34HP)				
Motor for tool clamp/unclamp unit	kW	0.75 (1.0	, , ,				
Feed motor (X, Y, Z, B)	kW	FANUC 5.5 (7.4HP) / 9.0 (12.1HP) / 6.0 (8.0HF	P) / IT: 2.7 (3.6HP) (BRT[Opt]: 4.5 (6.0HP))				
Hydraulic pump motor	kW	1.5 (2.0	OHP)				
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.7 (2.3HP) / 0.	.75 (1.0HP)				
Coolant pump motor	kW	50Hz: 0.7 (0.9HP) 60	0Hz: 1.2 (1.6HP)				
Motor for APC unit	kW	0.75 (1.0	OHP)				
Power supply 200VAC ±10% 50/60 ±1Hz 220VAC ±10% 60 ±1Hz <sup>-4</sup>	kVA	FANUC	61				
Compressed air supply	Pa, ℓ/min [ANR]	0.4~0.6*5, 500*6 (58~8	7 psi, 132 gal/min)				
Hydraulic unit tank capacity	l	20 (5.3	gal)				
Spindle and feed system cooling oil tank capacity	l	72 (19					
Magazine lubricating oil tank capacity	l	1 (0.3 g					
Coolant tank capacity	l	800 (211 gal)					
Machine height	mm	4,000 (157.48°)					
Required floor space	mm	3,682x6,395 (144.96"x251.77")					
Machine weight	kg	24,500 (54,000 lbs)	25,000 (55,000 lbs)				
Operating environment temperature		5~4	, , , ,				

\*1 BRT: Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°

\*2 Available under the HQ or hyper HQ control.

\*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.


\*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.


\*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS 88392-1 standard.

\*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.


#### **Dimentions** mm(in)


#### Floor Space

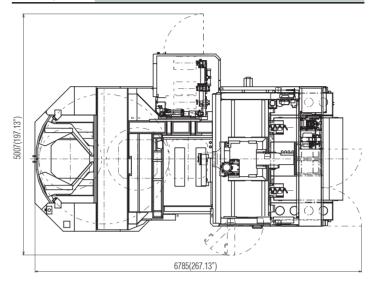

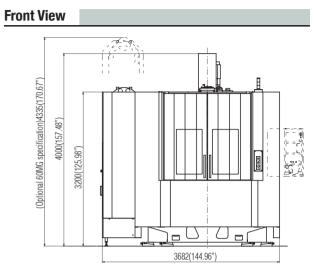


#### **Pallet Dimensions**

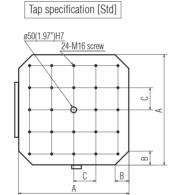

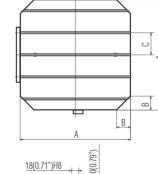

T-slot specification [Opt]

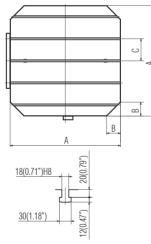


#### **Restriction on Tool**

Pallet dimensions mm											
	А	В	C	D							
HM800	800(31.5")	100(3.94")	160(6.30")	174(6.85")							
HM1000S	1000(39.37")	125(4.92")	200(7.87")	204(8.03")							
HM800(T-slot)	800(31.5")	100(3.94")	160(6.30")	204(8.03")							
HM1000S(T-slot)	1000(39.37")	125(4.92")	200(7.87")	214(8.43")							

MAX ø270(10.63") with tool in adjacent pot without tool in adjacent pot	MAX ø115(4.53")	MAX ø230(9.06") MIN 46(1.81") MIN 56(2.20")
	MAX 500(19.69"	)

#### XYZ axes travel diagrams

For executing the APC operation, the loaded workpiece must not exceed the specified maximum APC turning

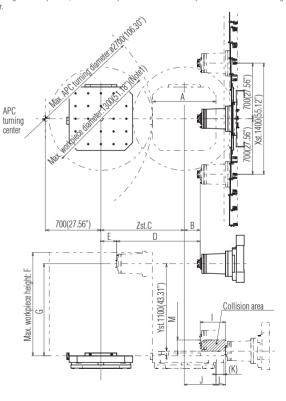

XYZ	axis	tr	avel	diagr	ams
					_


	AIL axis u	avcı ulayı	aiiio											mm(m)
		А	В	C	D	E	F	G	Н	I	J	K	L	М
	HM800	800(31.5")	200(7.87")	1050(41.34")	1050(41.34")	200(7.87")	1300(51.18")	1160(45.67")	60(2.36")	320(12.6")	400(15.75")	100(3.94")	120(4.72")	140(5.51")
	HM1000S	1000(39.37")	250(9.84")	1000(39.37")	1000(39.37")	250(9.84")	1270(50.00")	1130(44.49")	30(1.18")	400(15.75")	500(19.69")	125(4.92")	150(5.91")	140(5.51")
	HM800(T-slot)	800(31.5")	200(7.87")	1050(41.34")	1050(41.34")	200(7.87")	1270(50.00")	1130(44.49")	30(1.18")	320(12.6")	400(15.75")	100(3.94")	120(4.72")	140(5.51")
	HM1000S(T-slot)	1000(39.37")	250(9.84")	1000(39.37")	1000(39.37")	250(9.84")	1260(49.61")	1120(44.09")	20(0.79")	400(15.75")	500(19.69")	125(4.92")	150(5.91")	150(5.91")


Item		HM1000	HM12505					
Travel on X axis (Column: right/left)	mm	1700 (6	66.93")					
Travel on Y axis (Spindle head: up/down)	mm	1100 (55 107)						
Travel on Z axis (Table: back/forth)	mm	1400 (55.12")	1240 (48.82")					
Distance from pallet top surface to spindle center	mm	100~1500 (3.94"~59.06")	70~1470 (2.76"~57.87")					
Distance from pallet center to spindle nose	mm	200~1600 (7.87"~62.99")	360~1600 (14.17"~62.99")					
Pallet work surface area	mm	1000 (39.37")	1250 (49.21")					
Max. weight loadable on pallet	kg	(Uniform load)	3000 (6600 lbs)					
Pallet top surface configuration		24xM16 tap	24xM20 tap					
Minimum indexable angle of table	0	IT 1/ BRT [0	pt] 0.0001*1					
Table index time (for indexing 90 degrees)	sec	IT 5.0 / BR	T [Opt] 1.8					
Spindle speed	min-1	35~1:	2,000					
Number of spindle speed change steps		Electric 2-step sp	peed change (MS)					
Spindle inner taper		7/24 tap	er, No.50					
Spindle bearing inner diameter	mm	ø100 (	(3.94")					
Rapid traverse rate	m/min	48 (1,8	89 ipm)					
Cutting feed rate	mm/min	1~20,000 (0.0	04~787 ipm)*2					
Type of tool shank		JIS B 63	39 BT50					
Type of pull stud		OKK o	nly 90°					
Tool storage capacity	tool	40	)*3					
Maximum tool diameter	mm	ø115 (4.53") / ø270 (10.63")	without tool in adjacent pots					
Maximum tool length (from the gauge line)	mm	600 (2	23.62")					
Maximum tool weight	kg	25 (5:	5 lbs)					
Maximum tool moment	N·m	29.4 (21.	7 ft · lbs)					
Tool selection method		Address fixed i	random system					
Tool change time (cut-to-cut)	sec	6.2						
Pallet change method		Direc	et turn					
Pallet change time (JIS evaluation time)	sec	32.0	35.0					
spindle motor (30min/cont. rating)	AC, kW	FANUC 30 (40h	HP) / 25 (34HP)					
Motor for tool clamp/unclamp unit	kW	0.75 (	1.0HP)					
Feed motor (X, Y, Z, B)	kW	FANUC 5.0 (6.7HP) / 5.5x2 (7.4x2HP) / 5.0x2 (6.	.7x2HP) / IT: 3.0 (4.0HP) (BRT[Opt]: 5.5 (7.4HP))					
Hydraulic pump motor	kW	2.2 (3	3.0HP)					
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.7 (2.3HP) / 0.	.75x2 (1.0x2HP)					
Coolant pump motor	kW	50Hz: 0.7 (0.9HP)	60Hz: 1.2 (1.6HP)					
Motor for APC unit	kW	FANUC]: 1	.2 (1.6HP)					
Power supply 200VAC ±10% 50/60 ±1Hz 220VAC ±10% 60 ±1Hz*4	kVA	FANU	JC 72					
Compressed air supply	MPa, ℓ/min [ANR]	0.4~0.6*5, 500*6 (58-	~87 psi, 132 gal/min)					
Hydraulic unit tank capacity	l		.3 gal)					
Spindle and feed system cooling oil tank capacity	l	70x2 (18	1.5x2 gal)					
Magazine lubricating oil tank capacity	l	4 (1.	1 gal)					
Coolant tank capacity	l	800 (2	11 gal)					
Machine height	mm	3,717 (1	146.34")					
Required floor space	mm	5,530x8,195 (2°						
Machine weight	kg	31,000 (68,400 lbs)	32,500 (72,000 lbs)					
Operating environment temperature	°C	, , ,	40					

- \*1 BRT: Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°  $\,$
- \*2 Available under the HQ or hyper HQ control.
- \*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.
- \*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.
  \*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
- \*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.


**Dimentions** mm(in)


#### Floor Space

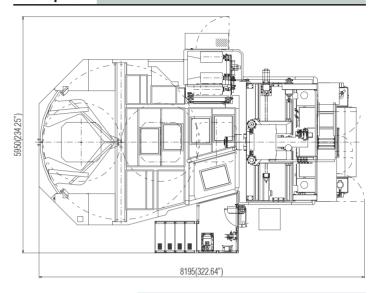

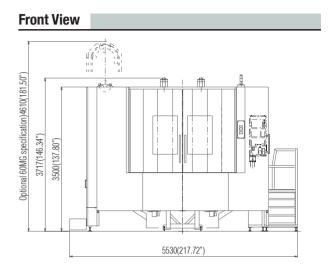

#### **Pallet Dimensions**

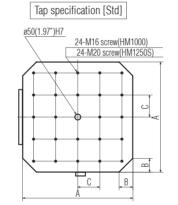

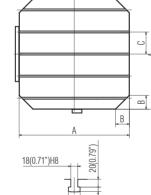

T-slot specification [Opt]


# 30(1.18")

	Restriction	n on Too	
(Note2) When three or more multiple magazines, 600mm (23.62") length tools	with tool in adjacent pot	Ø115(4.53")	#230(9.06")  MIN 46(1.81")  MIN 56(2.20")  MAX 600(23.62")(Not

are usable in the first and second magazines only. In the 3rd or the following magazines, the maximum tool length shall be limited to 500mm (19.69")

#### XYZ axes travel diagrams

(Note1)
For executing the APC operation, the loaded workpiece must not exceed the specified maximum APC turning

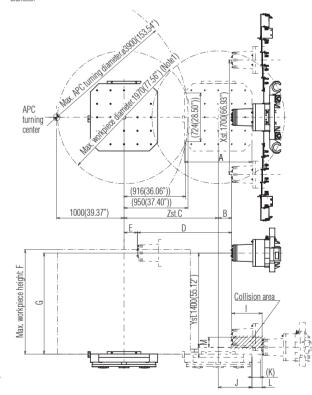

XYZ axis travel	l diagrams
-----------------	------------

**HM1000** | 1000 (39.37") | 125(4.92") | 200(7.87") | 208(8.19") HM1000(T-slot) |1000(39.37") |125(4.92") |200(7.87") |238(9.37") HM1250S 1250(49.21") 125(4.92") 250(9.84") 238(9.37") HM1250S(T-slot) 1250(4921") 125(4.92") 250(9.84") 258(10.16")

**Pallet dimensions** 

AT = UNIO LIUTOT UIUGTUITO						,	,						11111(111)	
		А	В	C	D	Е	F	G	Н	I	J	K	L	M
	HM1000	1000(39.37")	200(7.87")	1400(55.12")	1400(55.12")	200(7.87")	1550(61.02")	1500(59.06")	100(3.94")	450(17.72")	500(19.69")	125(4.92")	150(5.91")	150(5.91")
	HM1000(T-slot)	1000(39.37")	200(7.87")	1400(55.12")	1400(55.12")	200(7.87")	1520(59.84")	1470(57.87")	70(2.76")	450(17.72")	500(19.69")	125(4.92")	150(5.91")	180(7.09")
	HM1250S	1250(49.21")	360(14.17")	1240(48.82")	1240(48.82")	360(14.17")	1520(59.84")	1470(57.87")	70(2.76")	470(18.50")	625(24.61")	175.4(6.91")	205(8.07")	180(7.09")
	HM1250S(T-slot)	1250(49.21")	360(14.17")	1240(48.82")	1240(48.82")	360(14.17")	1500(59.06")	1450(57.09")	50(1.97")	470(18.50")	625(24.61")	175.4(6.91")	205(8.07")	180(7.09")